

---

# GPO

---

# Contract Terms

---

---

Quality Assurance Through  
Attributes Program  
for  
Printing and Binding

---

Prospective suppliers should carefully read this publication as the applicable attributes stated herein become an integral part of printing and binding contracts with the U.S. Government Printing Office when so cited in specifications. This copy should be retained for reference.

---

---



**GPO Publication 310.1**  
**Effective May 1979**  
**(Revised August 2002)**

GPO Contract Terms  
Quality Assurance Through Attributes Program  
For Printing and Binding  
Publication 310.1

is available as follows:

Prospective Bidders—

- \* Free single copies are available from the GPO Central Office Bid Room and all Regional Printing Procurement Offices.
- \* Bulk Copies are available from the Superintendent of Documents.

U.S. Government Agency Personnel—

- \* Copies are available from your GPO Customer Services Representative or Regional Printing Procurement Office through your agency's printing officer.

U.S. Government Printing Office Personnel—

- \* Individual copies are available from the Quality Assurance Section.
- \* Bulk copies are available from GPO Stores Division, Stock No. 51573-6.

Comments and suggestions from users of Contract Terms, Pub. 310.1, are invited. All such correspondence should be addressed as follows:

U.S. Government Printing Office  
North Capitol and H Sts., N.W.  
Chief, Quality Assurance Section  
Contract Management Branch  
Washington, DC 20401

Questions of applicability to individual contracts should be addressed to the respective Contracting Officer.

# Table of Contents

	Page
Foreword: QATAP—An Informational Overview .....	v
Definitions .....	1
Determination of Product Quality .....	2
Determining Acceptability .....	2
Categories of Attributes .....	2
Tolerance Table for Printing Attributes .....	3
Tolerance Table for Paper Attribute .....	3
Government Furnished Material .....	3
Printing Attributes .....	5
P-1. Hickies and Spots .....	5
P-2. Extraneous Marks .....	6
P-3. Moire .....	8
P-4. Register .....	9
P-5. Text and Illustration Image Position .....	11
P-6. Newton's Rings .....	14
P-7. Type Quality and Uniformity .....	15
P-8. Halftone Match .....	19
P-9. Solid or Screen Tints Color Match .....	22
P-10. Process Color Match .....	23
P-11. Rub Resistance of Printed Image .....	25
Finishing Attributes .....	27
F-1. Trim Size .....	27
F-2. Misplacement and Misalignment of Cover Image .....	29
F-3. Cover Position .....	31
F-4. Folding Position and Skewness .....	32
F-5. Perfect-Bound Book Durability .....	34
F-6. Loose Cover, Pages, and Binding .....	36
F-7. Excess Glue .....	37
F-8. Damaged Pages .....	38
F-9. Damaged Edges .....	40
F-10. Warpage of Case-Bound Books .....	41
F-11. Damaged Covers .....	42
F-12. Missing Pages .....	44
F-13. Upside Down Cover .....	44
F-14. Upside Down Pages .....	44
F-15. Blank Pages—Other Than Specified .....	44
F-16. Wrong Pagination .....	44
F-17. Loss of Information .....	44
F-18. A Serious Shift in Process Color Match .....	44
Guide for Equitable Reductions .....	45
Appendix A—Discount Table for Critical Defects .....	45
Appendix B—Discount Table for Major Defects .....	47
Appendix C—Printing and Binding Problem Index .....	51



# The U.S. Government Printing Office

## Quality Assurance Through Attributes Program (QATAP)

THIS FOREWORD IS NOT PART OF THE CONTRACT.  
IT IS PROVIDED FOR INFORMATIONAL PURPOSES ONLY.

### *QATAP—An Informational Overview*

The quality of printing and binding contracted for by the U.S. Government Printing Office (GPO) is addressed in three GPO documents.

First and foremost are the specifications for the specific contract being performed; these should be read and followed exactly. If there ever is a conflict between the specifications and the other two documents, the specifications take precedence. Next, *GPO Contract Terms (Publication 310.2)* is a part of every GPO contract by reference. Article 1 deals with quality requirements in a general manner. Third is *QATAP, Printing and Binding, Contract Terms (GPO Pub. 310.1)*, which specifies the contractual requirements of the Quality Assurance Through Attributes Program (QATAP). Most contracts incorporate it by reference.

The purposes of QATAP are:

- to provide for the precise expression, prior to production, of quality requirements for printing and related products; and
- to provide for the objective determination of conformity to these requirements once the product has been produced or received.

#### *The Quality Attributes*

QATAP is based on the use of quality attributes, which are measurable properties including tolerances of a printed piece which define its compliance with requirements. Quality attributes vary with each quality level.

The program has 30 attributes. Examples are trim size, measured in inches or centimeters; type density, measured in percent reflectance; and hickies and spots, measured by size and number present. The complete list of attributes is as follows:

- P-1 Hickies and Spots
- P-2 Extraneous Marks
- P-3 Moire
- P-4 Register
- P-5 Text and Illustration Image Position
- P-6 Newton's Ring
- P-7 Type Quality and Uniformity
- P-8 Halftone Match
- P-9 Solid or Screen Tints Color Match
- P-10 Process Color Match
- P-11 Rub Resistance of Printed Image

- F-1 Trim Size
- F-2 Misplacement and Misalignment of Cover Image
- F-3 Cover Position
- F-4 Folding Position and Skewness
- F-5 Perfect-Bound Book Durability
- F-6 Loose Cover, Pages, and Binding
- F-7 Excess Glue
- F-8 Damaged Pages
- F-9 Damaged Edges
- F-10 Warpage of Case-Bound Books (Cover and Text)
- F-11 Damaged Covers
- F-12 Missing Pages
- F-13 Upside Down Cover
- F-14 Upside Down Pages
- F-15 Blank Pages (Other than Specified)
- F-16 Wrong Pagination
- F-17 Loss of Information
- F-18 Serious Shift in Process Color

Paper (Subdivided into characteristics; e.g. color, opacity, smoothness.)

#### *Evaluation Standards*

For all but four of the numbered attributes and some paper characteristics, evaluation is made on an absolute basis, with defects assessed on deviation from explicit or implicit nominal values, rather than on comparisons to a specified physical object called the specified standard. For example, if the trim size is specified as 8 by 10 inches, these are the nominal values from which deviations are measured. Tolerances specify how far the product may deviate from the nominal and still be acceptable.

Specified standards are preidentified reference items (e.g., OK'd press sheets or furnished copy) with which sample items are compared to measure conformance for attributes P-7 through P-10 and some paper characteristics (e.g., paper color and formation). Another example, process color match (P-10) may be evaluated by comparing the printed illustration with an OK'd press sheet. In this instance the OK'd press sheet would have been listed in the job specifications as the specified standard for attribute P-10.

Thus, the evaluation for attributes P-7 through P-10, and some paper characteristics are made relative to a specified standard while the other attributes and paper characteristics are evaluated on an absolute basis.

#### *Product Quality Levels (PQL's)*

For each attribute, QATAP indicates either a specified standard or a nominal value along with tolerances that specify the range of acceptability. In either case, any necessary measuring instruments are listed.

Obviously, no single set of tolerances can apply to all products; for instance, tighter conformity is necessary on prestige products than on general information handouts or interoffice forms. Therefore, five Product Quality Levels (PQL's) have been established in QATAP, based primarily on the intended end use of the product.

These levels range from Best Quality (Level I) through Functional Quality (Level V), allowing successively more deviation from design characteristics and furnished reproducibles.

The PQL for each individual printing or binding job is selected by the customer agency, sometimes with GPO's assistance. The PQL is chosen based on the fidelity of reproduction required, the desired aesthetic appearance, and the intended durability of the final product.

Listed below are brief, general descriptions of the five quality levels; the exact definition of each level consists of the tolerances and standards listed in *QATAP Contract Terms, Printing and Binding, (GPO Pub. 310.1)*.

#### *Level I*

Descriptive Terms—Best quality, highest quality, tightest tolerances.

Fidelity of Reproduction—The information transmitted requires maximum fidelity to the furnished reproducibles in detail, color, and resolution.

Quality of Materials and Workmanship—These products typically involve the highest quality materials, reproducibles, production methods, and workmanship. Finishing must be held to the highest standards of accuracy, durability, and appearance.

Typical Physical Description—At this level products are generally multicolor or process color work. Illustrations may be very fine line drawings, multicolor illustrations, or up to 300-line screen halftones.

Examples of Tolerances—0.5 row of dots for multicolor halftone registration (see attribute P-4); one broken character per page for type quality (see P-7); and one-sixteenth of an inch for trim size (see F-1).

Note:—The tolerance examples shown for each PQL are the starting points at which demerits are assigned for printing attributes and defects for finishing attributes.

- As explained below, defects for printing attributes are based on demerits.
- As explained below, defects for printing, finishing and paper attributes are counted toward an acceptable quality level, which is used to determine acceptance or rejection.
- Some imperfections may by themselves render a product unacceptable.
- This note applies to examples of tolerances at all levels.

Examples—Art books, medical journals, and meat grading charts.

#### *Level II*

Descriptive Terms—Better quality, prestige quality, library quality.

Fidelity of Reproduction—Close fidelity to furnished reproducibles is required.

Quality of Materials and Workmanship—These products typically involve high quality materials, reproducibles, production methods, and workmanship.

**Typical Physical Description**—Overall appearance is of primary importance. Products in this level generally have singlecolor or multicolor subject matter. Finishing must be held to high standards of accuracy, durability, and appearance.

**Examples of Tolerances**—One row of dots for multicolor halftone registration (see attribute P-4); one broken character per page for type quality (see P-7); and three-thirtyseconds of an inch for trim size (see F-1). See note regarding tolerance examples in Level I.

**Examples**—Yearbooks, recruiting materials, and illustrated professional papers.

### *Level III*

**Descriptive Terms**—Good quality, above average quality.

**Fidelity of Reproduction**—Illustrations must transmit precise information even though fidelity to minutest detail is not required.

**Quality of Materials and Workmanship**—Typically involves above average quality materials, reproducible, production methods, and workmanship.

**Typical Physical Description**—Generally requires clean, sharp printing of single- or multi-color work (general process color work) and halftone reproductions up to 150-line screen. Finishing must be held to above average standards of accuracy, durability, and appearance.

**Examples of Tolerances**—One row of dots for multicolor halftone registration (see attribute P-4); two broken characters per page for type quality (see P-7); and one-eighth of an inch for trim size (see F-1). See note regarding tolerance examples in Level I.

**Examples**—Annual reports, general process color work, court decisions, budget reports, catalogs, textbooks.

### *Level IV*

**Descriptive Terms**—Basic quality, informational quality, utility quality.

**Fidelity of Reproduction**—Average fidelity and resolution to original copy or film is required.

**Quality of Materials and Workmanship**—Requires average quality materials, reproducible, production methods, and workmanship.

**Typical Physical Description**—Products that provide general information, usually black and white or line color (nonprocess) and occasional halftone reproductions. Utility is important, as well as basic, clean appearance. Finishing must be of an accuracy, durability, and appearance that does not impair the function of the product.

**Examples of Tolerances**—Multicolor halftone registration is not applicable (see attribute P-4); six broken characters per page for type quality (see P-7); and three-sixteenths of an inch for trim size (see F-1).

See note regarding tolerance examples in Level I.



Examples—Telephone directories, indexes, project reports (technical manuals without process color and with only occasional halftones).

#### *Level V*

Descriptive Terms—Functional quality, lowest usable quality, greatest tolerances.

Fidelity of Reproduction—Considered of adequate quality provided there is no information loss.

Quality of Materials and Workmanship—Considered of adequate quality provided there is no information loss and the finishing does not impair the function of the product. These products may be reproduced from any readable copy.

Typical Physical Description—One color type and line work only.

Examples of Tolerances—Multicolor halftone register is not applicable (see attribute P-4); broken characters are not applicable (see P-7); and greater than one-fourth inch for trim size (see F-1). See note regarding tolerance examples in Level I.

Examples—Interoffice forms, line-only information handouts.

#### *Mixing Product Quality Levels*

The foregoing implies a unique PQL for each product. Actually, in some instances it may be desirable to mix quality levels. For example, a bound volume for which heavy use is anticipated may require Level II conformity to attributes related to life and durability, but only Level III conformity to attributes dealing with the quality of the printed image.

#### *Definition of Defects*

For each attribute and PQL, QATAP provides tolerances which are the allowable deviation from nominal values or specified standards.

For some of the attributes (e.g., number of flexes to loosen a page), different amounts of deviation from the specified values have vastly different effects on the usability of the finished product. Thus, two different types of defects (major and critical) have been defined.

The major defect, is based on a deviation from specifications or standards which normally would be noticed by the customer; e.g., excessively low type density.

Critical defects are those which render a product extremely difficult to use, or even unusable; e.g., loss of information is always assessed as a critical defect.

Thus, for attributes P-1 through P-11, F-18, and the paper attribute, QATAP assesses only major defects, except when loss of information occurs. For attributes F-1 through F-17, major or critical defects can be assessed.

#### *Inspection by Attributes*

Each attribute of each item inspected (individual book, pamphlet etc.) is classified as acceptable, defective at the major level, or defective at the critical level. Therefore, each item can have more than one defect.

(See *QATAP Contract Terms, for Printing and Binding (GPO Pub. 310.1)*.)

Specifically, for each printing attribute, P-1 through P-11, demerits are assessed to each page measured. Then the item is assessed a major defect for that attribute if the average demerit level (ADL) per page for that attribute exceeds 4.0.

If the ADL does not exceed 4.0, but if one or more pages is so obviously defective that it significantly impairs the quality of the entire copy, then a single major defect (Conspicuous Single Page Defect) will be assigned for that printing attribute. Examples are: a large hickey at the focal point of an illustration, P-1; a single page with extremely light (but legible) type, P-7; large ink or oil spots, P-1; large off-color spots in process color illustrations, P-10.

For the finishing attributes, F-1 through F-18, no ADL is used to determine defects, nor does the Conspicuous Single Page Defect provision apply. Instead, for each finishing attribute, the individual item is inspected and if necessary, assessed a major defect or a critical defect in accordance with the applicable tolerance table.

QATAP provides for the evaluation of paper characteristics by inspection and testing in accordance with the standards in Part 2, *Government Paper Specification Standards*. Demerits are assessed for each characteristic that deviates from nominal values or specified standards. Then, if the sum of the demerits for that item is 31 or more, the item is assessed a major defect under QATAP.

In summary, each individual item can be inspected for all applicable attributes and then assessed a specific number of major or critical defects; e.g., seven major defects and one critical defect.

#### *Acceptance Sampling*

There is an inherent variability in every group of manufactured items. One could inspect every item in the lot, but the cost would be prohibitive.

Therefore, determining the acceptability of an entire job, which may contain thousands of individual items, is somewhat more complicated than the inspection of a single item as described above.

One alternative to 100 percent inspection is a formal process called acceptance sampling which can be employed in many cases to determine the acceptability of an entire job.

Acceptance sampling involves the use of statistics applied to the results of inspecting each item in a representative sample taken from an entire job or shipment, hereafter called a lot. *ANSI/ASQC Z 1.4 Sampling Procedures and Tables for Inspection by Attributes* (ANSI/ASQC Z 1.4 version in effect as of date of bid opening) prescribes the sample size appropriate for varying lot sizes under various circumstances. A full description of the acceptance sampling process is contained in *Government Printing Office, Technical Report No. 27, Acceptance Sampling*.

#### *Acceptable Quality Levels (AQL's)*

After selecting and inspecting a representative sample, the question is whether to accept or reject the entire lot based on those results.

Under QATAP, a contractor is not allowed to knowingly ship any defective products. However, in many circumstances, a customer may tolerate a limited, predefined percentage of defective items in a ship-

ment that have not been caught by the contractor's quality system. It is the job of *QATAP, Printing and Binding, Contract Terms (GPO Pub. 310.1)* and *ANSI/ASQC Z 1.4 Sampling Procedures and Tables for Inspection by Attributes*, to define this risk.

Therefore, in order to determine acceptance or rejection of the entire lot, an Acceptable Quality Level (AQL) must be established. The AQL specifies the maximum defects per 100 units (as a process average) considered satisfactory for that lot.

The purpose of sampling and inspection is to determine statistically whether the AQL has been exceeded. Typical AQL's for Government contracts are 1.0 defects per 100 items for critical defects, and 6.5 defects per 100 items for total defects, i.e., major defects plus critical defects.

#### *Acceptability or Rejection of the Lot*

After sampling and inspection, the appropriate tables in publication *ANSI/ASQC Z 1.4 Sampling Procedures and Tables for Inspection by Attributes*, are checked to determine for the sample size being used the number of defects that will render the lot acceptable or rejectable, i.e., the number of defects in the sample that correspond to the AQL.

In a typical situation, a product that exceeds the AQL of 1.0 for critical defects or 6.5 for total defects is not deemed acceptable, and the Government has the option of having the lot replaced or the defects corrected, if possible.

In a limited number of cases, where circumstances do not allow reprinting and use "as is" is necessary, QATAP provides the Government the option of accepting the lot with an equitable reduction in the contract price. *QATAP, Printing and Binding, Contract Terms*, provides discount tables to determine such reductions.

#### *Intent of QATAP*

While QATAP allows acceptance of a defective lot under an equitable reduction in contract price, in all cases it is the intent of the Government that all of the items meet the quality specified in the contract.

Furthermore, the goal of QATAP is not only enforcement of quality standards through inspection, but also that contractors establish quality control systems that assure production of a product that meets the standards set forth in the contract.

#### *Referenced Documents*

Copies of the referenced documents can be obtained as follows:

\**GPO Contract Terms—(GPO Pub. 310.2) and*

\**QATAP, Printing and Binding, Contract Terms (GPO Pub. 310.1)*

Free single copies are available to prospective bidders from the GPO Central Office Bid Room and all Regional Printing Procurement Offices.

Bulk quantities are available from the Superintendent of Documents, Washington, DC 20402, telephone (202) 512-1800.

*\*Government Paper Specification Standards*

Subscriptions are available from the Superintendent of Documents, Washington, DC 20402, telephone (202) 512-1800.

*\*Sampling Procedures and Tables for Inspection by Attributes (ANSI/ASQC Z 1.4)*

Copies of ANSI/ASQC Z 1.4 are available from the American National Standards Institute, 11 West 42nd Street, New York, NY 10036; telephone (212) 642-4900; fax (212) 302-1286.

*\*Technical Report No. 26, The GPO Quality Attributes Program—An Update and Technical Report No. 27, Acceptance Sampling*

Free single copies are available from the U.S. Government Printing Office, Quality Assurance Section (Stop PPSQ), Washington, DC 20401, telephone (202) 512-0542.

Note: For all publications, U.S. Government agency personnel should contact their GPO customer service representative or regional printing procurement office through their agency's printing officer.

---

## *QATAP SUMMARY*

- \* There are 30 measurable attributes.
- \* The attributes are evaluated against nominal values or specified standards.
- \* There are five Product Quality Levels (PQL's), I-Best, through V-Functional.
- \* For the printing attributes:
  - Demerits are assigned if specified tolerances are exceeded.
  - When an individual copy has an Average Demerit Level (ADL) of more than 4.0 (4 per page), the copy is assessed a major defect.
  - When the ADL is 4.0 or less, if a conspicuous single page defect is present, a single major defect can be assessed to the appropriate printing attribute.
- \* For the other attributes (excluding paper):
  - Major and critical defects can be assessed.
- \* For the paper attribute:
  - Demerits are assessed in accordance with *Government Paper Specification Standards*.
  - If the demerits equal 31 or more, a major defect is assessed.
- \* Loss of Information for any reason is assessed a critical defect.
- \* Total Defects are the sum of major and critical defects in the entire sample inspected.
- \* The Acceptable Quality Level (AQL) is the maximum number of defects per 100 units the government will tolerate the risk of accepting at the contract price.
  - A typical AQL is 1.0 for critical defects and 6.5 for total defects.
- \* Acceptance Sampling, an alternative to inspecting every unit in the lot, can be used to determine if the entire lot meets the AQL.
  - The appropriate sample size for determining a representative sample is derived by using *ANSI/ASQC Z 1.4, Sampling Procedures and Tables for Inspection by Attributes* (version in effect as of date of bid opening).
- \* If the defects exceed either or both AQL's:
  - The government has the option of having the lot replaced or corrected if possible, or accepting the lot with an equitable reduction in the contract price.

---

(END OF INFORMATIONAL FOREWORD)









## Quality Assurance Through Attributes Program (QATAP)

### 1. DEFINITIONS

1-1. *Quality Attribute*—A quality attribute is a property of a printed product which affects its quality. Examples are trim size, image position, type quality, and paper.

1-2. *Lot or Batch*—A lot or batch is a quantity of copies of a publication from which a sample is drawn. A lot or batch consists of copies which are produced under essentially the same conditions and at essentially the same time.

1-3. *Critical Defect*—A critical defect is a serious deviation from specifications. Critical defects are designated in the tolerance tables for finishing attributes.

1-4. *Major Defect*—A major defect is a deviation from specifications which is less serious than a critical defect. Major defects are designated in the tolerance tables for printing attributes, finishing attributes and the paper attribute.

1-5. *Total Defects*—Total defects are the sum of all critical and all major defects (e.g., 3 critical defects + 2 major defects = 5 total defects).

1-6. *Acceptable Quality Levels (AQL's)*—The AQL's are the maximum number of defects per 100 copies that the Government will accept at the contract price. Unless otherwise specified, the AQL's are 1.0 for critical defects and 6.5 for total defects.

1-7. *Product Quality Levels (PQL's)*—The PQL's specify the degree of quality required in the final product. QATAP contains five PQL's ranging from Level I (Best) to Level V (Functional). Generally, tolerances for attributes vary with the PQL.

1-8. *Inspection Levels*—The inspection levels are the means used to determine the relationship between the lot or batch size and the minimum sample size. Inspection Levels will be specified in accordance with page 9 of "ANSI/ASQC Z 1.4, Sampling Procedures and Tables for Inspection by Attributes" (version in effect as of date of bid opening). Copies of ANSI/ASQC Z 1.4 are available from the American National Standards Institute, 11 West 42nd Street, New York, NY 10036; telephone (212) 642-4900; fax (212) 302-1286.

1-9. *Specified Standards*—The specified standards are the criteria on which printing attributes P-7, P-8, P-9, and P-10 are evaluated. For example, process color match (P-10) might be evaluated by comparing a printed illustration with an "OK'd press sheet." In this example, the "OK'd press sheet" would be listed in the specifications as the specified standard for printing attribute P-10.

Standards will be specified for the following attributes:

P-7	Type Quality and Uniformity
P-8	Halftone Match
P-9	Solid or Screen Tints Color Match
P-10	Process Color Match

1-10. *Average Demerit Levels (ADL's)*—ADL's are one of the means used to classify defects for printing attributes.

1–11. *Standard Viewing Conditions*—Standard viewing conditions are those defined in ISO 3664–2000, Viewing conditions—Graphic technology and photography.

## 2. DETERMINATION OF PRODUCT QUALITY

a. QATAP establishes attributes for quality and it defines tolerances for those attributes for five quality levels of printing. When attributes deviate from the allowable tolerances, the deviations will be classified as either major or critical defects pursuant to the applicable tolerance table.

b. Attributes which are not identified as quality attributes under QATAP (e.g., stitching position) will be evaluated in accordance with the article entitled “Quality” in U.S. Government Printing Office Contract Terms (Pub. 310.2).

3. DETERMINING ACCEPTABILITY—Because inspection of all copies of a publication is usually impractical, the Government will utilize statistical sampling to determine quality. When the Government determines that both the number of critical defects and the number of total defects in the lot or batch do not exceed their respective AQLs, the lot or batch will be accepted at the contract price. ANSI/ASQC Z 1.4, Sampling Procedures and Tables for Inspection by Attributes, will be used to make this determination.

If the defects exceed either or both AQLs, the Government will have the option of having the lot or batch replaced, having the defects corrected, or accepting the lot or batch with an equitable reduction in the contract price. The discount tables contained in Appendices A & B will be used as a guide by the Contracting Officer to determine reductions. Failure to agree to such reduction of price shall be a dispute concerning a question of fact within the meaning of the article entitled “Disputes” of GPO Contract Terms (Publication 310.2). In all cases it is the intent of the Government that the products meet the quality required in the specifications.

4. CATEGORIES OF ATTRIBUTES—Quality attributes are divided into three categories which consist of printing attributes, finishing attributes, and the paper attribute.

4–1. *Printing Attributes*—For each copy that is inspected, the Government will evaluate each applicable printing attribute by separately inspecting:

- a. outside covers (i.e., the spine and covers 1 & 4)
- b. text (i.e., pages and covers 2 & 3)

ADLs will be determined as follows:

- (i) Outside covers will be inspected and evaluated as one unit. The unit will be assessed demerits (i.e., 4, 20, 100) pursuant to the demerit table for each printing attribute that deviates from specifications. The demerits which are assessed constitute the ADL for outside covers for that printing attribute for that copy.
- (ii) The text will be evaluated by inspecting pages (each page is an individual unit), cover 2, and cover 3 as individual units. Each unit will be assessed demerits (i.e., 4, 20, 100) pursuant to the demerit table for each printing attribute that deviates from specifications. The demerits which are assessed will be summed, and each sum will be divided by the number of individual units that were inspected for that printing attribute. The quotient constitutes the ADL for text for that printing attribute for that copy.
- (iii) In each copy the ADLs for each printing attribute will be classified as follows:

Tolerance Table for Printing Attributes

<i>ADL's</i>	<i>Classification of Defect</i>
4 or less for both outside covers and text . . . . .	None.
More than 4 for either or both outside covers and text . . . . .	Major.

*Conspicuous Single Page Defects*—When one or more pages have been assessed demerits for a printing attribute but the ADL does not exceed 4, a single major defect will be assessed for that printing attribute if one or more pages is so conspicuously defective that it significantly impairs the quality of the entire copy. Examples include a large hickey at the focal point of an illustration, a single page with extremely light (but legible) type, large ink spots, large oil spots, and large off-color spots in illustrations.

4-2. *Finishing Attributes*—The Government will evaluate finishing attributes by inspecting individual copies of publications. When each copy is inspected, each applicable finishing attribute that deviates from specifications will be classified as either a critical or major defect in accordance with the tolerance table for that attribute.

4-3. *Paper Attribute*—The Government will evaluate the paper attribute by inspecting and testing paper characteristics in individual copies of publications. The paper characteristics will be tested in accordance with the current edition of “Government Paper Specification Standards” which is published by the Joint Committee on Printing. When each copy is inspected, paper that deviates from specifications will be assessed a major defect.

Tolerance Table for the Paper Attribute

<i>Sum of Demerits</i>	<i>Classification of Defect</i>
Less than 31 . . . . .	None.
31 or more . . . . .	Major.

5. GOVERNMENT FURNISHED MATERIAL (GFM)—Defects will not be assessed for deviations from specifications which are caused by GFM if the contractor notifies the Government prior to production that the GFM is not satisfactory.



## Printing Attributes

### P-1. Hickies and Spots

*Definition:* Hickies and spots are small deformities, specks, or other imperfections on a page, cover, or spine, which result from the printing or reproduction process.

*Examples:* Ink spatter, hickies caused by dirty blanket, spots due to paper picking.

- Instruments:*
1. Visual evaluation
  2. Magnifier with scale graduated in increments of .1 mm or .005 inch

*Procedure:* 1. Evaluate hickies, off-color spots, and ink spots in accordance with the following table:

<i>Diameter</i>	<i>Count</i>
less than 1 mm (.04 in.) .....	1
1 to but not including 2 mm (.08 in.) .....	3
2 through 3 mm (.12 in.) .....	15
greater than 3 mm (.12 in.) .....	45

**Demerit Table for Hickies and/or Spots**

Product Quality Levels		<i>Demerits</i>		
		4	20	100
Level I	5 to and including 14 counts .....	X		
	15 to and including 29 counts .....		X	
	greater than 29 counts .....			X
Level II	10 to and including 19 counts .....	X		
	20 to and including 39 counts .....		X	
	greater than 39 counts .....			X
Level III	20 to and including 29 counts .....	X		
	30 to and including 49 counts .....		X	
	greater than 49 counts .....			X
Level IV	30 to and including 39 counts .....	X		
	greater than 39 counts .....		X	
Level V	Not applicable to Level V .....			

## P-2. Extraneous Marks

*Definitions and Examples:* Extraneous marks are undesirable marks which are not hickies or spots. Examples are lines due to plate scratches, scumming, tinting, wheel marks, oil marks, and ink bleed-through. Showthrough is not evaluated under this attribute. The two categories of deviations for extraneous marks are:

Category 1: These are marks which are readable on a densitometer and which cover an area measuring more than 1/4 inch (6.4 mm) in their smallest dimension. Examples are scumming, set off, and smearing.

Category 2: These are marks that do not fall in Category 1. Examples are roller marks, gear marks, lines due to scratches on negative or plate, and ink bleed-through.

Category 2 marks are classified according to seriousness as follows:

- a. *Light Marks*—Light marks are marks which are visible under standard viewing conditions and which slightly detract from the appearance of a page. Examples are visible marks measuring less than .010 square inch (6.5 square millimeters) in total area.
- b. *Medium Marks*—Medium marks are marks that moderately detract from the appearance of a page. Examples are visible marks measuring between .010 and .020 square inch (between 6.5 and 12.9 square millimeters) in total area.
- c. *Heavy Marks*—Heavy marks are marks that seriously detract from the appearance of a page. Examples are marks greater than .020 square inch (12.9 square millimeters) in total area. Marks caused by foreign matter such as oil will always be classified as heavy marks.

*Instruments:*

1. Visual Evaluation
2. Reflection Densitometer
3. Magnifier with scale graduated in increments of .005 inch (.1 millimeter)

*Procedures:*

### *Category 1*

- a. Use a reflection densitometer with the filter giving the highest reading.
- b. Measure the three areas of greatest density in the mark. Compute the average and assign demerits on the average.

### *Category 2*

- a. Visually inspect the marks under standard viewing conditions.
- b. Classify the marks based on the above criteria.
- c. Measure area of mark only if there is a dispute regarding the classification.

*Demerit Assessment*

Assess demerits on the more defective of the two categories. A maximum of 100 demerits will be assessed per page.

**Demerit Table for Extraneous Marks (Category 1)**

Product Quality Levels		Demerits		
		4	20	100
Level I	Visible to but not including 0.01 density .....	X		
	0.01 through and including 0.02 density .....		X	
	greater than 0.02 density .....			X
Level II	0.01 to but not including 0.02 density .....	X		
	0.02 through and including 0.03 density .....		X	
	greater than 0.03 density .....			X
Level III	0.02 to but not including 0.03 density .....	X		
	0.03 through and including 0.04 density .....		X	
	greater than 0.04 density .....			X
Level IV	0.03 to but not including 0.04 density .....	X		
	0.04 through and including 0.05 density .....		X	
	greater than 0.05 density .....			X
Level V	Not applicable to Level V .....			

**Demerit Table for Extraneous Marks (Category 2)**

Product Quality Levels		Demerits		
		4	20	100
Level I	Light Marks .....		X	
	Medium Marks .....			X
	Heavy Marks .....			X
Level II	Light Marks .....	X		
	Medium Marks .....		X	
	Heavy Marks .....			X
Level III	Light Marks .....	X		
	Medium Marks .....		X	
	Heavy Marks .....			X
Level IV	Light Marks .....	X		
	Medium Marks .....	X		
	Heavy Marks .....		X	
Level V	Not applicable to Level V .....			

### P-3. Moire

*Definitions:*

1. Moire is defined as objectionable patterns which are created when halftone screens are printed over one another at incorrect screen angles. Moire may also appear when rescreening a single color halftone or screening an original halftone which contains patterned objects (e.g., fabrics).

2. Avoidable moire is moire that is due to poor production methods rather than the inherent limitations of the process (e.g., 15 degree yellow screen angle, rescreened halftones).

*Instruments:*

1. Visual Evaluation
2. Screen Angle Gauge

*Procedures:*

1. Visually examine halftone under standard viewing conditions.
2. Determine the deviation of each color from the desired screen angle by means of a screen angle gauge.

**Demerit Table for Moire**

Product Quality Levels		<i>Demerits</i>		
		4	20	100
Level I	Any avoidable moire . . . . .			X
Level II	Avoidable moire through and including .5° . . . . . greater than .5° . . . . .		X	X
Level III	Avoidable moire through and including .5° . . . . . .5° through and including 1.0° . . . . . greater than 1.0° . . . . .	X	X	X
Level IV	.5° to but not including 1.0° . . . . . 1.0° through and including 1.5° . . . . . greater than 1.5° . . . . .	X	X	X
Level V	Not applicable to Level V . . . . .			



## P-4. Register

*Definition:* Register is the alignment of two or more image components. The two categories of register are:

1. Multicolor Halftone Register (Internal and/or Border)
2. Linework Register (solid colors)

*Instruments:*

1. Visual Evaluation
2. Magnifier with scale graduated in increments of .1 mm or .005 inch

*Procedures:*

1. *Multicolor Halftone Register (Internal and/or Border)* Establish the measuring base by determining two colors in register within 0.5 row. Sum the rows of misregister for all colors. Enter the sum on the demerit table to assign demerits. If three or more colors are used and no two colors register within 1 row, assign 100 demerits to that page. If more than one illustration appears on a page, assess demerits only on the most defective illustration. A maximum of 100 demerits will be assessed per page.
2. *Linework Register (Solid Colors and Specialty Screens)* Establish the measuring base by determining two colors in register within 0.10 mm. Using a magnifier with a graduated scale, measure in millimeters the misregister for each color. Sum the measurements of misregister for all colors. Enter sum on the demerit table to assign demerits. If no two colors are in register within 0.10 mm, select as the measuring base the color which will result in the smallest number of demerits.

**Demerit Table for Multicolor Halftone Register**

Product Quality Levels		Demerits		
		4	20	100
Level I	.5 to but not including 1 row	X		
	1 through and including 2 rows		X	
	greater than 2 rows			X
Level II	1 to but not including 2 rows	X		
	2 through and including 3 rows		X	
	greater than 3 rows			X
Level III	1 to but not including 2 rows	X		
	2 through and including 4 rows		X	
	greater than 4 rows			X
Level IV	Not applicable to Level IV			
Level V	Not applicable to Level V			

### Demerit Table for Solids and Linework

Product Quality Levels	<i>Demerits</i>		
	4	20	100
Level I			
	.10 mm (.004 in.) to but not including .20 mm (.008 in.) . . . . .	X	
	.20 mm (.008 in.) through and including .30 mm (.012 in.) . . . . .		X
	greater than .30 mm (.012 in.) . . . . .		X
Level II			
	.10 mm (.004 in.) to but not including .20 mm (.008 in.) . . . . .	X	
	.20 mm (.008 in.) through and including .30 mm (.012 in.) . . . . .		X
	greater than .30 mm (.012 in.) . . . . .		X
Level III			
	.20 mm (.008 in.) to but not including .30 mm (.012 in.) . . . . .	X	
	.30 mm (.012 in.) through and including .40 mm (.016 in.) . . . . .		X
	greater than .40 mm (.016 in.) . . . . .		X
Level IV			
	.40 mm (.016 in.) to but not including .50 mm (.020 in.) . . . . .	X	
	.50 mm (.020 in.) through and including .60 mm (.024 in.) . . . . .		X
	greater than .60 mm (.024 in.) . . . . .		X
Level V	Not applicable to Level V . . . . .		

## P-5. Text and Illustration Image Position

*Definitions:* The two categories of deviations for image position are:

1. *Misplacement*—Misplacement is the linear displacement of the image between the specified and actual position.
2. *Skewness*—Skewness is the angular displacement of the image in relation to the edges of the page.


*Examples:* Unintentional bleeds, incorrect placement of text, and improper alignment of two-page spreads.

*Instruments:*

1. Visual
2. Ruler graduated to 1/64 and .010 inches (or .1 mm)

*Procedures:*

1. *Misplacement*  
By means of a ruler, determine vertical and horizontal deviations of the printed image position from the specified position. Assess demerits on the greater deviation.
2. *Exceptions:*
  - a. *Image Bleeds*  
If either a specified image bleed does not occur or an unspecified image bleed does occur, assess 100 demerits for Levels I, II and III and 20 demerits for Level IV.
  - b. *Facing Pages*  
When the vertical deviations of facing pages are in opposite directions from the specified position, sum the measurements of the two deviations. Using the demerit table for misplacement, assess demerits based on the combination of the two pages. For example, in a level III book, one margin is 3/32 inch high and the facing page margin is 2/32 inch low. Assess a total of 20 demerits to the two pages combined based on the sum of 5/32 inch.
  - c. *Saddle Stitched Publications*  
Allowances will be made for normal trade practices for margins of saddle stitched publications.
3. *Skewness*  
Measure the distance from the printed image to the edge of the page at two points on the same edge, exactly five inches (127 millimeters) apart (see illustration). Calculate the difference in the two measurements ( $D_1 - D_2$ ) and assess demerits based on this difference. If a five-inch (127 millimeters) distance is not available, extend the edges of the copy and the image to five inches (127 millimeters).
4. *Demerit Assessment*  
Assess demerits for each category. A maximum of 200 demerits will be assessed per page.

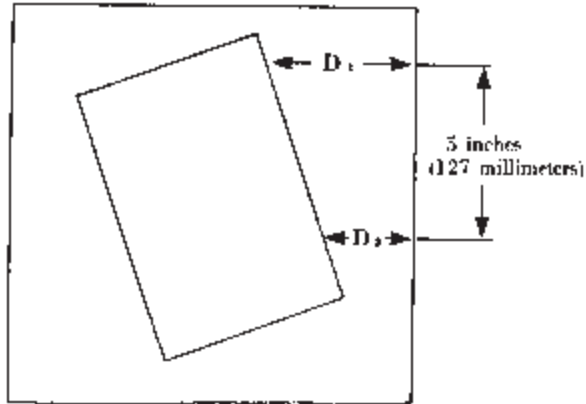

**1. Demerit Table for Misplacement**

Product Quality Levels	Demerits		
	4	20	100
Level I			
1/32 in. (.8 mm) to but not including 1/16 in. (1.6 mm)	X		
1/16 in. (1.6 mm) through and including 1/8 in. (3.2 mm)		X	
greater than 1/8 in. (3.2 mm.)			X
Level II			
1/32 in. (.8 mm) to but not including 1/16 in. (1.6 mm)	X		
1/16 in. (1.6 mm) through and including 1/8 in. (3.2 mm)		X	
greater than 1/8 in. (3.2 mm)			X
Level III			
1/16 in. (1.6 mm) to but not including 1/8 in. (3.2 mm)	X		
1/8 in. (3.2 mm) through and including 3/16 in. (4.8 mm)		X	
greater than 3/16 in. (4.8 mm)			X
Level IV			
1/8 in. (3.2 mm) to but not including 3/16 in. (4.8 mm)	X		
3/16 in. (4.8 mm) through and including 1/4 in. (6.4 mm)		X	
greater than 1/4 in. (6.4 mm)			X
Level V			
Not applicable to Level V			

**2. Demerit Table for Skewness**

Product Quality Levels	(D <sub>1</sub> -D <sub>2</sub> at 5" distance)	Demerits		
		4	20	100
Level I	.02 in. (.5 mm) to but not including .04 in. (1.0 mm) .....	X		
	.04 in. (1.0 mm) through and including .09 in. (2.3 mm) .....		X	
	greater than .09 in. (2.3 mm) .....			X
Level II	.02 in. (.5 mm) to but not including .04 in. (1.0 mm) .....	X		
	.04 in. (1.0 mm) through and including .09 in. (2.3 mm) .....		X	
	greater than .09 in. (2.3 mm) .....			X
Level III	.02 in. (.5 mm) to but not including .09 in. (2.3 mm) .....	X		
	.09 in. (2.3 mm) through and including .18 in. (4.6 mm) .....		X	
	greater than .18 in. (4.6 mm) .....			X
Level IV	.04 in. (1.0mm) to but not including .09 in. (2.3 mm) .....	X		
	.09 in. (2.3 mm) through and including .18 in. (4.6 mm) .....		X	
	greater than .18 in. (4.6 mm) .....			X
Level V	Not applicable to Level V .....			

Approximate Equivalent Degrees of Skewness

	Degrees of Skewness
.02 .....	1/4°
.04 .....	1/2°
.09 .....	1°
.13 .....	1-1/2°
.18 .....	2°
.26 .....	3°

## P-6. Newton's Rings

*Definition:* Newton's rings are irregular circles which are caused by interference (e.g., tape, dirt, etc.) with good contact or by poor contact printing technique.

*Examples:* Printed halftones and screen tints that have a bleached and/or mottled appearance.

*Instruments:* Visual

- Procedures:*
1. Determine the presence of Newton's rings in a single or multicolor halftone by making a visual comparison under standard viewing conditions between the original camera copy and the sample being inspected.
  2. Determine the presence of Newton's rings in single color or multicolor screen tints by a visual examination of the sample under standard viewing conditions without the use of camera copy.

**Demerit Table for Newton's Rings**

Product Quality Levels	<i>Demerits</i>		
	4	20	100
Level I	Any visible Newton's rings		X
Level II	Any visible Newton's rings		X
Level III	Any visible Newton's rings	X	
Level IV	Any visible Newton's rings	X	
Level V	Not applicable to Level V		

## P-7. Type Quality and Uniformity

- Evaluation:* Type will be evaluated in four ways:
1. Minimum Type Density (maximum % reflectance).
  2. Variation in Type Density (% reflectance) between facing pages, within a page, or from an “OK’d press sheet.”
  3. Deviation in Type Dimension from the specified standard.
  4. Broken characters.

- Instruments:*
1. Visual
  2. Print Contrast Meter (% reflectance convertible to density)
  3. 8x type size finder
  4. 50x microscope with reticle calibrated to .001"

- Procedures:*
1. *Minimum Type Density (maximum % reflectance).*  
Inspect each page visually to locate minimum type density (maximum % reflectance).  
Make dry readings of the three lightest characters with a print contrast meter. Compute the average of the readings and assess demerits based on it.
  2. *Variation in Type Density (% reflectance) between facing pages, within a page, or from an “OK’d press sheet.”*  
Compare measurements for each individual page inspected against a % reflectance reading for its facing page, against each other for variation within a page, or against those of an “OK’d press sheet.”
  3. *Type Dimension*  
Evaluate type dimension by comparing measurements of the finished publication with the specified standard. Use the 50x microscope or print contrast meter to measure type dimensions. Tolerances are based on the maximum deviation from the specified standard.
  4. *Broken Characters*  
Count the number of broken characters on each page.
  5. *Demerit Assessment*  
Assess demerits on all of the four categories. A maximum of 400 demerits will be assessed per page.

These tolerances will also be used for the line widths and ink density of line illustrations.

- Exception:* Evaluation 1 “Minimum Type Density (maximum % reflectance)” and evaluation 2 “Variation in Type Density (% reflectance) between facing pages, within a page, or from an ‘OK’d press sheet’” will not apply to type printed with colored ink (i.e., a type other than black). Instead, type printed with colored ink will be evaluated for visible density variation (1) between facing pages (2) within a page (3) between the page and the specified standard listed for attribute P-9 “Solids or Screen Tints Color Match.” Each page containing any of these variations will be assessed 100 demerits at Levels I and II, and 20 demerits at Levels III and IV.

### 1. Demerit Table for Minimum Type Density or Maximum Percent Reflectance

Product Quality Levels	Demerits		
	4	20	100
Level I	Gloss Coated Paper		
	5% reflectance to 10% .....	X	
	11% reflectance to 15% .....		X
	16% reflectance or greater .....		X
	Matte Finish, Coated Paper		
	7% reflectance to 10% .....	X	
	11% reflectance to 15% .....		X
	16% reflectance or greater .....		X
Level II	Gloss Coated Paper		
	6% reflectance to 12% .....	X	
	13% reflectance to 17% .....		X
	18% reflectance or greater .....		X
	Matte Finish, Coated Paper		
	8% reflectance to 12% .....	X	
	13% reflectance to 17% .....		X
	18% reflectance or greater .....		X
	Uncoated Paper		
11% reflectance to 13% .....	X		
	14% reflectance to 18% .....		X
	19% reflectance or greater .....		X
Level III	Gloss Coated Paper		
	7% reflectance to 13% .....	X	
	14% reflectance to 18% .....		X
	19% reflectance or greater .....		X
	Matte Finish, Coated Paper		
	9% reflectance to 13% .....	X	
	14% reflectance to 18% .....		X
	19% reflectance or greater .....		X
	Uncoated Paper		
13% reflectance to 14% .....	X		
	15% reflectance to 19% .....		X
	20% reflectance or greater .....		X
Level IV	Gloss Coated Paper		
	9% reflectance to 14% .....	X	
	15% reflectance to 19% .....		X
	20% reflectance or greater .....		X
	Matte Finish, Coated Paper		
	11% reflectance to 14% .....	X	
	15% reflectance to 19% .....		X
	20% reflectance or greater .....		X



**1. Demerit Table for Minimum Type Density or Maximum Percent Reflectance—Continued**

Product Quality Levels	<i>Demerits</i>		
	4	20	100
Uncoated Paper			
16% reflectance to 19% .....	X		
20% reflectance to 24% .....		X	
25% reflectance or greater .....			X
Newsprint			
20% reflectance to 24% .....	X		
25% reflectance to 29% .....		X	
30% reflectance or greater .....			X
Level V	Not applicable to Level V .....		

**Equivalent Densities for Percent Reflectance**

Percent Reflectance	Density	Percent Reflectance	Density	Percent Reflectance	Density
2	1.70	12	.92	22	.66
3	1.52	13	.89	23	.64
4	1.40	14	.85	24	.62
5	1.30	15	.82	25	.60
6	1.22	16	.80	26	.59
7	1.15	17	.77	27	.57
8	1.10	18	.74	28	.55
9	1.05	19	.72	29	.54
10	1.00	20	.70	30	.52
11	.96	21	.68		

**2. Demerit Table for Percent Reflectance Variation**

Product Quality Levels	(Between facing pages, within a page, or from an "Ok'd press sheet")	<i>Demerits</i>		
		4	20	100
Level I	2% to but not including 3% reflectance .....	X		
	3% through and including 4% reflectance .....		X	
	greater than 4% reflectance .....			X
Level II & III	3% to but not including 4% reflectance .....	X		
	4% through and including 5% reflectance .....		X	
	greater than 5% reflectance .....			X
Level IV	4% to but not including 5% reflectance .....	X		
	5% through and including 6% reflectance .....		X	
	greater than 6% reflectance .....			X
Level V	Not applicable to Level V .....			

### 3. Demerit Table for Type Dimension\*

Product Quality Levels		Demerits		
		4	20	100
Level I	.002 in. (.05 mm) to but not including .003 in. (.08 mm) . . . . .	X		
	.003 in. (.08 mm) through and including .004 in. (.10 mm) . . . . .		X	
	greater than .004 in. (.10 mm) . . . . .			X
Level II	.002 in (.05 mm) to but not including .003 in. (.08 mm) . . . . .	X		
	.003 in. (.08 mm) through and including .004 in. (.10 mm) . . . . .		X	
	greater than .004 in. (.10 mm) . . . . .			X
Level III	.003 in (.08 mm) to but not including .004 in. (.10 mm) . . . . .	X		
	.004 in. (.10 mm) through and including .005 in. (.13 mm) . . . . .		X	
	greater than .005 in. (.13 mm) . . . . .			X
Level IV	.004 in (.10 mm) to but not including .005 in. (.13 mm) . . . . .	X		
	.005 in. (.13 mm) through and including .006 in. (.15 mm) . . . . .		X	
	greater than .006 in. (.15 mm) . . . . .			X
Level V	Not applicable to Level V			

\*1 point equals 0.0138" (.351 mm)

### 4. Demerit Table for Broken Characters

Product Quality Levels		Demerits		
		4	20	100
Level I	1 to 2 broken characters . . . . .	X		
	3 to 5 broken characters . . . . .		X	
	greater than 5 characters . . . . .			X
Level II	1 to 2 broken characters . . . . .	X		
	3 to 5 broken characters . . . . .		X	
	greater than 5 characters . . . . .			X
Level III	2 to 3 broken characters . . . . .	X		
	4 to 6 broken characters . . . . .		X	
	greater than 6 characters . . . . .			X
Level IV	6 to 8 broken characters . . . . .	X		
	greater than 8 characters . . . . .		X	
Level V	Not applicable to Level V . . . . .			

## P-8. Halftone Match (Single and Double Impression)

- Definitions:*
1. If the “Ok’d press sheet” is the specified standard, the halftone match is the density deviation between the “OK’d press sheet” and the reproduction in the highlights, middletones, and shadows.
  2. When the “furnished negatives” are the specified standard, the tone reproduction curve is determined by the negative. However, the contractor is required to meet the minimum solid ink density and to maintain dot structure and two page spread requirements, allowing for normal dot gain from the “furnished negatives.”
  3. When the “camera copy” is the specified standard, the solid ink density, dot structure, and two-page spread requirements shall apply to halftone match. Because proofs such as dyluxes and veloxes do not truly reflect the quality of the finished product, their “OK” by the ordering agency does not relieve the contractor from meeting these tolerances.

- Instruments:*
1. Visual Evaluation
  2. Reflection densitometer
  3. Magnifier

- Procedures:*
1. *All specified standards.*
    - a. Assess 20 demerits if highlight or shadow dot structure is not maintained in the reproduction and 100 demerits if detail is lost. However, normal dropout of extreme highlights is acceptable.

Assess 20 demerits for excessive compression of highlights or shadows (e.g., midtone shifts).
    - b. If a visible density shift occurs in a single illustration that occupies a two-page spread, for each page assess 100 demerits at Levels I and II, and 20 demerits at Levels III and IV.
    - c. Make a densitometer reading in an area with solid ink density.
      - (1) For single impression halftones, use the densitometer filter that indicates the highest total density.
      - (2) For double impression black halftones, make comparative readings with the visual filter.
      - (3) For two-color duotones, make comparative densitometer readings with the two filters that indicate the highest readings.
    - d. Assess demerits only on the most defective of the three areas. Assess a maximum of 100 demerits per page for single color and double black halftones and 200 demerits for two-color halftones.

2. "OK'd Press Sheet" as the Specified Standard.
  - a. Zero densitometer to the paper.
  - b. Make comparative dry measurements between the "OK'd press sheet" and the reproduction in corresponding highlight and middletone areas.

**Demerit Table for Highlights**

Highlight densities are measured from an area of not less than 0.15 density on the "OK'd press sheet."

Product Quality Levels		Demerits		
		4	20	100
Level I	± .03 to but not including ± .04	X		
	± .04 through and including ± .05		X	
	greater than ± .05			X
Level II	± .04 to but not including ± .05	X		
	± .05 through and including ± .06		X	
	greater than ± .06			X
Level III	± .06 to but not including ± .07	X		
	± .07 through and including ± .08		X	
	greater than ± .08			X
Level IV	± .07 to but not including ± .08	X		
	± .08 through and including ± .09		X	
	greater than ± .09			X
Level V	Not applicable to Level V			

**Demerit Table for Middletones**

Middletone densities are measured from an area between 0.45 to 0.60 on "OK'd press sheet."

Product Quality Levels		Demerits		
		4	20	100
Level I	± .10 to but not including ± .11	X		
	± .11 through and including ± .12		X	
	greater than ± .12			X
Level II	± .11 to but not including ± .12	X		
	± .12 through and including ± .13		X	
	greater than ± .13			X
Level III	± .12 to but not including ± .15	X		
	± .15 through and including ± .20		X	
	greater than ± .20			X
Level IV	± .15 to but not including ± .20	X		
	± .20 through and including ± .25		X	
	greater than ± .25			X
Level V	Not applicable to Level V			

**Demerit Table for Shadows**

Tolerances in the shadow areas are based on the following solid ink densities:

single impression black halftones

coated stock .....	1.40
uncoated stock .....	1.10

double impression black halftones

coated stock .....	1.70
uncoated stock .....	1.30

Product Quality Levels		<i>Demerits</i>		
		4	20	100
Level I	-.02 to but not including -.06 .....	X		
	-.06 through and including -.12 .....		X	
	greater than -.12 .....			X
Level II	-.02 to but not including -.08 .....	X		
	-.08 through and including -.16 .....		X	
	greater than -.16 .....			X
Level III	-.02 to but not including -.10 .....	X		
	-.10 through and including -.20 .....		X	
	greater than -.20 .....			X
Level IV	-.02 to but not including -.10 .....	X		
	-.10 through and including -.25 .....		X	
	greater than -.25 .....			X
Level V	Not Applicable to Level V .....			

## P-9. Solid or Screen Tints Color Match

*Definition:* Solid or screen tints color match is the density deviation between the reproduction and the specified standard. There are three solid and/or screen tint categories:

1. Single Color Solids or Tints
2. Multicolor Solids or Tints
3. Process Color Solids or Tints

*Instruments:*

1. Visual Evaluation
2. Reflection Densitometer

*Procedures:*

1. For single color solids or tints, make a dry comparative densitometer reading using the filter that will indicate the highest density.
2. For multicolor solids or tints, make a dry comparative densitometer reading using the filter that will indicate the highest density.
3. For process color solids or tints, use the scoring system for Process Color Halftones (P-10) to determine demerits.

*Exceptions:* If a visible density shift occurs within or between, solids or tints (on a single page or on a two-page spread), 100 demerits at Levels I and II, and 20 demerits at Levels III and IV will be assessed for each page.

**Demerit Table for Solids and/or Screen Tints**

Product Quality Levels		Demerits		
		4	20	100
Level I	± .05 to but not including ± .10 density	X		
	± .10 through and including ± .15 density		X	
	greater than ± .15 density			X
	Visible variation within a solid			X
Level II	± .07 to but not including ± .12 density	X		
	± .12 through and including ± .17 density		X	
	greater than ± .17 density			X
	Visible variation within a solid			X
Level III	± .09 to but not including ± .14 density	X		
	± .14 through and including ± .19 density		X	
	greater than ± .19 density			X
	Visible variation within a solid		X	
Level IV	± .12 to but not including ± .17 density	X		
	± .17 through and including ± .22 density		X	
	greater than ± .22 density			X
	Visible variation within a solid		X	
Level V	Not applicable to Level V			

## P-10. Process Color Match

- Definitions:*
1. Process color match is the fidelity of color match between the item being inspected and the specified standard.
  2. A perceptible shift is a shift in color between the specified standard and the sample, that is perceptible under standard viewing conditions but is not large enough to be classified as objectionable.
  3. An objectionable shift is a shift between the specified standard and the sample causing a definite change of color. Examples are fleshtones shifting slightly towards a yellow or magenta hue, green grass taking on a yellow or cyan cast, browns turning slightly reddish or yellowish, and overall density change.
  4. A serious shift is a shift between the specified standard and the sample causing a change of color approaching misrepresentation or loss of identity. Examples are fleshtones, browns, and grays turning green or purple, green grass turning brown or magenta, and plugged shadows or washed out highlights.

- Instruments:*
1. Visual Inspection
  2. Densitometer

- Procedures:*
1. Compare sample with specified standard for shifts in hue, saturation, and lightness under standard viewing conditions (see paragraph 1-11, "Standard Viewing Conditions").
  2. Assess demerits in accordance with the table below (maximum 100 demerits per page).
  3. When a sample of production run press sheets (fan) is required:
    - a. Assess demerits to each page.
    - b. Combine corresponding sample numbers from all fans to construct a set of "equivalent books."
    - c. Calculate an ADL for each equivalent book.

### Demerit Table for Process Color Match

Product Quality Levels		<i>Demerits</i>		
		4	20	100
Level I	Perceptible shift .....		X	
	Objectionable shift .....			X
	Serious shift: (See finishing attribute F-18) .....			
Level II	Perceptible shift .....	X		
	Objectionable shift .....		X	
	Serious shift .....			X
Level III	Objectionable shift .....		X	
	Serious shift .....			X
Level IV	Not applicable to Level IV .....			
Level V	Not applicable to Level V .....			



## P-11. Rub-Resistance of Printed Image

*Definition:* Rub-resistance is the resistance of the printed image to smearing onto similar stock when rubbed with that stock. There are two categories of rub-resistance:

1. Rub-Resistance of Unvarnished Image
2. Rub-Resistance of Varnished Image

*Instruments:*

1. Visual Evaluation
2. Reflection Densitometer
3. Rub Tester (Sutherland or equivalent)

*Procedures:*

1. *Unvarnished Image*
  - a. Calibrate the densitometer to the blank strip of stock.
  - b. Test a representative sample of the printed product on the Rub Tester. Give a 3" x 6" (76.2 mm x 152.4 mm) printed sample 25 rubs at a pressure of 1.0 P.S.I. against a 2" x 5/4" (50.8 mm x 133.4 mm) blank strip of stock similar to that on which the sample is printed.
  - c. Make three density readings in the area of highest density on the blank 2" x 5/4" (50.8 mm x 133.4 mm) test strip. Use the densitometer filter which indicates the maximum density for the color of ink used in the printed sample.
  - d. Calculate an average density for the rub-off smear based on the three independent density readings.
  - e. Perform all tests at least 72 hours after the printing operation.
2. *Varnished Image*  
Follow the same procedure as above with the exception that each sample will be given 50 rubs at a pressure of 1.0 P.S.I. (.70308 gm/mm2).

### 1. Demerit Table for Rub-Resistance of Unvarnished Image

Product Quality Levels		Demerits		
		4	20	100
All Levels	Type			
	.04 through and not including .05 density	X		
	.05 through and including .06 density		X	
	greater than .06 density			X
All Levels	Halftones			
	.05 through and not including .06 density	X		
	.06 through and including .07 density		X	
	greater than .07 density			X
All Levels	Solids			
	.06 through and not including .07 density	X		
	.07 through and including .08 density		X	
	greater than .08 density			X

## 2. Demerit Table for Rub-Resistance of Varnished Image

Product Quality Levels		<i>Demerits</i>		
		4	20	100
Level I	.12 to but not including .14 density .....	X		
	.14 through and including .16 density .....		X	
	greater than .16 density .....			X
Level II	.12 to but not including .14 density .....	X		
	.14 through and including .16 density .....		X	
	greater than .16 density .....			X
Level III	.12 to but not including .14 density .....	X		
	.14 through and including .16 density .....		X	
	greater than .16 density .....			X
Level IV	Not applicable to Level IV .....			
Level V	Not applicable to Level V .....			


## Finishing Attributes

### F-1. Trim Size

- Definitions:*
1. Nonspecified trim size is any deviation in the specified horizontal or vertical trim size.
  2. Nonflush trim is any variation in length or width within a copy.
  3. Unsquare trim is defined as the angular misalignment of the trimmed edges of a copy.

- Instruments:*
1. Visual Evaluation
  2. Ruler graduated in 1/64 and .020 inches or .1 mm.

- Procedure:*
1. *Nonspecified Trim Size*  
Determine the largest deviations of the horizontal and vertical trim from the specified size. Classify the defect based on these deviations.
  2. *Nonflush Trim*  
Determine the greatest deviations in length and width between two pages in the copy. Classify the defect based on the greater deviation.
  3. *Unsquare Trim*
    - a. Draw a line perpendicular to the edge where the maximum angular misalignment occurs (see diagrams).
    - b. Measure distances  $D_1$  and  $D_2$  from this line to the edge that should be parallel to it.
    - c. Classify the defect based on the value of  $D_1 - D_2$ .

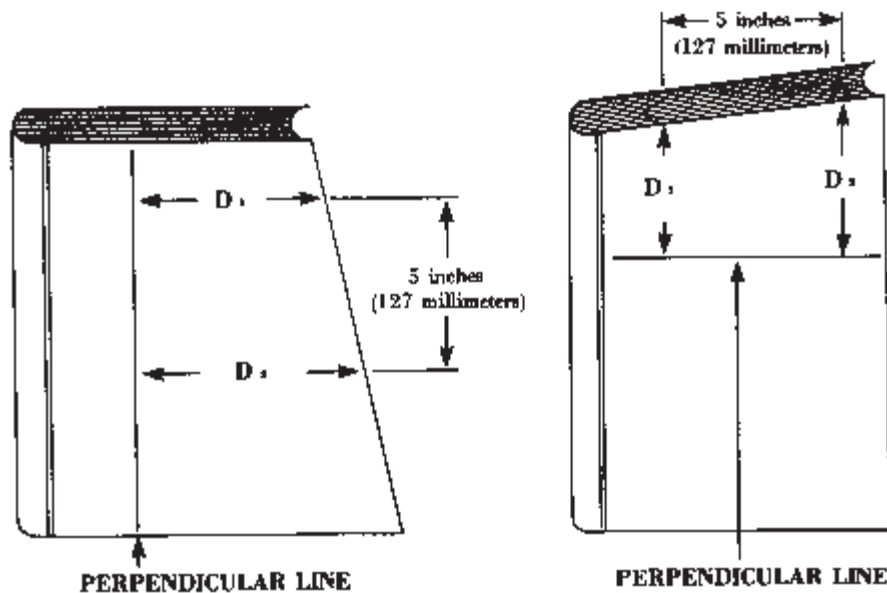

4. *Limitation*

Classify a single defect based on the most defective of the three categories.

**1 & 2. Tolerance Table for Trim Size and/or Nonflush Trim**

Product Quality Levels		<i>Classification of Defect</i>
		Major
Level I	greater than 1/16 in. (1.6 mm) . . . . .	X
Level II	greater than 3/32 in. (2.4 mm) . . . . .	X
Level III	greater than 1/8 in. (3.2 mm) . . . . .	X
Level IV	greater than 3/16 in. (4.8 mm) . . . . .	X
Level V	greater than 1/4 in. (6.4 mm) . . . . .	X

**3. Tolerance Table for Unsquare Trim**

Product Quality Levels		<i>Classification of Defect</i>
(D <sub>1</sub> -D <sub>2</sub> at 5" distance)		Major
Level I	greater than .04 in. (1.0 mm) . . . . .	X
Level II	greater than .04 in. (1.0 mm) . . . . .	X
Level III	greater than .09 in. (2.3 mm) . . . . .	X
Level IV	greater than .09 in. (2.3 mm) . . . . .	X
Level V	greater than .13 in. (3.3 mm) . . . . .	X

**Approximate Equivalent Degrees of Skewness**


Deviation D <sub>1</sub> -D <sub>2</sub>	Degrees of Skewness
.02 . . . . .	1/4°
.04 . . . . .	1/2°
.09 . . . . .	1°
.13 . . . . .	1-1/2°
.18 . . . . .	2°
.26 . . . . .	3°

## F-2. Misplacement and Misalignment of Cover Image

- Definitions:*
1. Misplacement is the difference between the specified and actual location of a printed image on a cover.
  2. Misalignment is the angular displacement from specifications of a printed image on a cover.

- Instruments:*
1. Visual Evaluation
  2. Ruler graduated in 1/64 and .020 inches or .1 mm.

- Procedures:*
1. *Misplacement*  
Measure both vertical and horizontal margins for conformance to specified dimensions. Classify the defect based on the greatest deviation.
  2. *Misalignment*  
Measure the distance from the printed image to the edge of the cover at two points on the same edge exactly five inches (127 mm) apart (see illustration). If a 5-inch (127 mm) distance is not available on the copy being inspected, extend the image and edge of the cover on a blank sheet. Calculate the difference between the two measurements ( $D_1 - D_2$ ). Classify the defect based on this difference.
  3. *Limitation*  
Classify a single defect based on the more defective of the two categories.

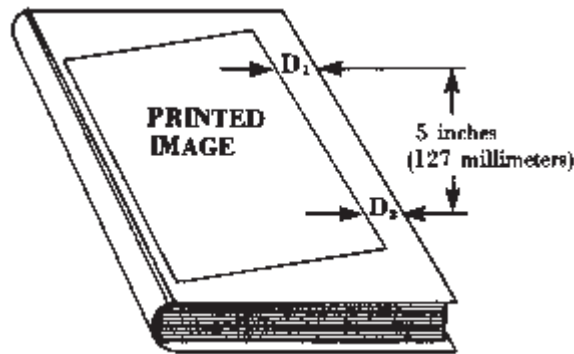

**1. Tolerance Table for Misplacement of Cover Image**

Product Quality Levels		<i>Classification of Defect</i>
		Major
Level I	greater than 1/16 in. (1.6 mm) . . . . .	X
Level II	greater than 1/16 in. (1.6 mm) . . . . .	X
Level III	greater than 3/32 in. (2.4 mm) . . . . .	X
Level IV	greater than 1/8 in. (3.2 mm) . . . . .	X
Level V	greater than 3/16 in. (4.8 mm) . . . . .	X

**2. Tolerance Table for Misalignment of Cover Image**

Product Quality Levels	(D <sub>1</sub> -D <sub>2</sub> at 5" distance)	<i>Classification of Defect</i>
		Major
Level I	greater than .04 in. (1.0 mm) . . . . .	X
Level II	greater than .04 in. (1.0 mm) . . . . .	X
Level III	greater than .09 in. (2.3 mm) . . . . .	X
Level IV	greater than .18 in. (4.6 mm) . . . . .	X
Level V	greater than .18 in. (4.6 mm) . . . . .	X

**Approximate Equivalent Degrees of Skewness**

Deviation D <sub>1</sub> -D <sub>2</sub>	Degrees of Skewness
.02 . . . . .	1/4°
.04 . . . . .	1/2°
.09 . . . . .	1°
.13 . . . . .	1-1/2°
.18 . . . . .	2°
.26 . . . . .	3°

### F-3. Cover Position

- Definitions:*
1. Cover position is defined as the specified distance between the position of the text and endleaves in relation to the cover.
  2. Text flush with cover is defined as a misalignment or misplacement of the text in relation to the cover to such a degree that the text and/or endleaves extend to the edge of the cover.
  3. Cover and text overlap is defined as a misalignment or misplacement of the text in relation to the cover to such a degree that the text and/or endleaves extend beyond the edge of the cover.

- Instruments:*
1. Visual Evaluation
  2. Ruler graduated in 1/16 inch or .1 mm.

- Procedure:*
1. Measure the distance from the edge of the cover to the endleaf at the shortest point.

**Tolerance Table for Cover Position**

Product Quality Levels		Classification of Defect	
		Major	Critical
Levels I-V	Less than or equal to 1/16 in. (1.6 mm) to the point where the text and/or endleaf is flush with the cover. . . . .	X	
	Any cover and text overlap . . . . .		X

## F-4. Folding Position and Skewness (Folded Forms and Brochures)

*Definitions:* 1. A deviation in folding position is the difference between the specified and actual position of a fold.

2. Folding skewness is the angular displacement of a fold from the specified position.

*Instruments:* 1. Ruler graduated in 1/64 and .020 inches or .1 mm.  
2. Visual Evaluation

*Procedures:* 1. *Deviations in Folding Position*  
Measure the maximum deviation of the fold from the specified position.

2. *Folding Skewness*  
Measure the distance from the fold to the specified fold line at two points exactly 5 inches (127 mm) apart. If a 5-inch (127 mm) distance is not available, extend the two lines on a blank sheet. Calculate the difference in the two measurements and classify the defect on this value.

3. *Limitation*  
Classify only one defect based on the more defective of the two categories.

### 1. Tolerance Table for Deviation in Folding Position

Product Quality Levels		<i>Classification of Defect</i>
		Major
Level I	greater than 1/16 in. (1.6 mm) . . . . .	X
Level II	greater than 1/16 in. (1.6 mm) . . . . .	X
Level III	greater than 1/16 in. (1.6 mm) . . . . .	X
Level IV	greater than 3/32 in. (2.4 mm) . . . . .	X
Level V	greater than 3/32 in. (2.4 mm) . . . . .	X

### 2. Tolerance Table for Folding Skewness

Product Quality Levels	(D <sub>1</sub> -D <sub>2</sub> at 5" distance)	<i>Classification of Defect</i>
		Major
Level I	greater than .18 in. (4.6 mm) . . . . .	X
Level II	greater than .18 in. (4.6 mm) . . . . .	X
Level III	greater than .18 in. (4.6 mm) . . . . .	X
Level IV	greater than .26 in. (6.6 mm) . . . . .	X
Level V	greater than .26 in. (6.6 mm) . . . . .	X



---

**Approximate Equivalent Degrees of Skewness**

---

Deviation $D_1 - D_2$	Degrees of Skewness
.02 .....	$1/4^\circ$
.04 .....	$1/2^\circ$
.09 .....	$1^\circ$
.13 .....	$1-1/2^\circ$
.18 .....	$2^\circ$
.26 .....	$3^\circ$

---

## F-5. Perfect-Bound Book Durability

*Definition:* Perfect-bound book durability is defined as the durability of the adhesive binding under tests that simulate normal usage of the book during its expected useful life. Four tests will be used:\*

1. Subway Test
2. Page Pull Test
3. Page Flex Test
4. Adhesive Temperature Stability Test

*Instruments:*

1. Page Pull Tester
2. Flex Tester
3. Scale
4. Oven
5. Refrigerator

*Procedures:*

1. *Subway Test*  
Open the book completely and bring the covers back to back. Perform this test in a minimum of three places: 1/4, 1/2, and 3/4 of the way through the book. Perform the test at 75° F. ± 10° F. (23.9° C. ± 5.6° C.).
2. *Page Pull Test*  
Test pages for the pounds of pull per inch of backbone required to separate the page from the adhesive line. Perform this test in a minimum of three places: 1/4, 1/2, and 3/4 of the way through the book. The defect is classified based on the lowest pull value of the pages tested. Perform the test at 75° F. ± 10° F. (23.9° C. ± 5.6° C.).
3. *Page Flex Test*  
Flex a page with 2.5 pounds (1,134 gm) of pull until the page separates from the adhesive line or reaches 126 flexes. Perform this test in a minimum of three places: 1/4, 1/2, and 3/4 of the way through the book. Record the exact page numbers chosen for the test. If a test page separates from the adhesive line, retest that area of the book by moving 10 pages (5 leaves) in either direction from the original location of the defective page. Two failures are required in a book before a defect is classified and the test may be terminated when two pages fail. The defect is classified by using the lowest number of flexes for any of the selected locations in the book. Perform the test at 75° F. ± 10° F. (23.9° C. ± 5.6° C.). *Note:* Failure of individual pages in tests 2 and 3 at a point other than the adhesive line will not be classified as a defect in the perfect binding.
4. *Adhesive Temperature Stability Test*  
Test the book per 1, 2, or 3 after it has undergone the following treatment:
  - a. Condition book at 130° F. ± 5° F. (54.4° C. ± 2.8° C.) for 72 hours.
  - b. Condition book at 22° F. ± 5° F. (—5.6° C. ± 2.8° C.) for 72 hours.
  - c. Condition book at 75° F. ± 10° F. (23.9° C. ± 5.6° C.) for 6 hours.

---

\*An individual book should not be used in more than one of the tests.

5. *Limitation*

Only the most serious defect resulting from the tests above will be classified. For example, if a page pull is a major defect and page flex is a critical defect, the book would be assessed a single critical defect.

**Tolerance Table for Perfect-Bound Book Durability**

Product Quality Levels		Classification of Defect	
		Major	Critical
1. SUBWAY TEST			
All levels	Any loosening of pages at any location .....		X
2. PAGE PULL TEST			
All levels	2.0 lbs per inch (35.7g/mm) of backbone to and including 1.5 lbs per inch (26.8g/mm) of backbone.	X	
	Less than 1.5 lbs per inch (26.8g/mm) of backbone .....		X
3. PAGE FLEX TEST			
All levels	125 to and including 75 flexes .....	X	
	Less than 75 flexes .....		X

## F-6. Loose Cover, Pages, and Binding

*Definition:* Loose covers are defined as covers which are inadequately attached to the text. The three categories are:

1. Case-bound Cover
2. Glued Cover
3. Sewn or Stitched Cover

*Instruments:* 1. Visual Evaluation

- Procedures:*
1. *Case-bound Cover*  
Inspect end sheets for wrinkles, bubbles, tears, looseness, tears in the gutter, and improper adherence of end sheets to cover. Inspect cover for looseness of binding materials such as headbands, backing, and crash.
  2. *Glued Cover*  
Inspect the cover and text to determine that they adhere to the spine at all points.
  3. *Sewn or Stitched Cover*  
Inspect for any looseness of the cover or text due to any improper stitching, sewing, and/or any signature starts.

### Tolerance Table for Loose Cover or Binding

Product Quality Levels		Classification of Defect	
		Major	Critical
All levels	1. Case-bound		
	Wrinkles or bubbles in end sheets, end sheets loose or torn around the edges (with the cover securely fastened), or any looseness of binding materials.		X
	End sheets not glued securely all the way to the joint, or end sheet torn in gutter.		
	X		
All levels	2. Glued Cover		
	Any looseness of cover or text . . . . .	X	
	Any separation of cover or text from book . . . . .		X
All levels	3. Sewn or Stitched		
	Any looseness of cover or text due to stitches or threads, and/or any signature starts . . . . .	X	
	Any separation of cover or text from book . . . . .		X

## F-7. Excess Glue

*Definition:* This is defined as glue which is visible on the outside edge or the inside of the cover and/or text.

*Instruments:*

1. Visual Evaluation
2. Ruler

*Procedures:*

1. Hold the ruler perpendicular to the glue line.
2. Measure the glue line at the point of maximum spread to determine the classification.

**Tolerance Table for Gluing**

Product Quality Levels		<i>Classification of Defect</i>
		Major
Level I	Greater than 1/8 in. (3.2 mm) . . . . .	X
Level II	Greater than 1/8 in. (3.2 mm) . . . . .	X
Level III	Greater than 3/16 in. (4.8 mm) . . . . .	X
Level IV	Greater than 1/4 in. (6.4 mm) . . . . .	X
Level V	Greater than 1/4 in. (6.4 mm) . . . . .	X

## F-8. Damaged Pages

*Definition:* Damaged pages consist of the following categories:

1. Wrinkles radiating from the fold of a book
2. Dog-ears and wrinkles greater than 1/8 of an inch (3.2 mm) in width
3. Connected or torn pages

*Instruments:* 1. Visual

*Procedures:*

1. Calculate the percentage of damaged pages in relation to the number of pages in the book.
2. Classify a single defect based on the most defective of the three categories.

### 1. Tolerance Table for Damaged Pages Wrinkles radiating from the fold

Product Quality Levels		<i>Classification of Defect</i>
		Major
Level I	Greater than 5% .....	X
Level II	Greater than 8% .....	X
Level III	Greater than 12% .....	X
Level IV	Greater than 15% .....	X
Level V	Greater than 25% .....	X

### 2. Tolerance Table for Damaged Pages Dog-ears and wrinkles greater than 1/8 of an inch

Product Quality Levels		<i>Classification of Defect</i>
		Major
Level I	A single dog-ear or wrinkle .....	X
Level II	Greater than 2% .....	X
Level III	Greater than 3% .....	X
Level IV	Greater than 5% .....	X
Level V	Greater than 7% .....	X

**3. Tolerance Table for Damaged Pages  
Connected or torn pages**

Product Quality Levels		<i>Classification of Defect</i>
		Major
Level I	A single connected or torn page .....	X
Level II	Greater than 2% .....	X
Level III	Greater than 5% .....	X
Level IV	Greater than 7% .....	X
Level V	Greater than 10% .....	X

## F-9. Damaged Edges

*Examples:* Examples of damaged edges are untrimmed signatures and edges which are feathered, ragged, or burred.

*Instruments:*

1. Visual Evaluation
2. Clear Plastic Grid consisting of 1/4 in. (6.35 mm) squares.

*Procedures:*

1. Measure damaged edges by placing the clear plastic grid over the entire edge where the damage is located.
2. Count the number of squares which cover the damage.
3. Calculate the percentage of squares containing the damage in relation to the number of squares within the entire edge.
4. Classify the defect based on the edge of the copy that contains the most damage.

**Tolerance Table for Damaged Edges**

Product Quality Levels		Classification of Defect	
		Major	Critical
Level I	Any visible burred, feathered, or ragged edges . . . . .	X	
	Any untrimmed signatures . . . . .		X
Level II	Greater than 5% burred, feathered, or ragged edges . . . . .	X	
	Any untrimmed signatures . . . . .	X	
Level III	Greater than 10% burred, feathered, or ragged edges . . . . .	X	
	Any untrimmed signatures . . . . .	X	
Level IV	Greater than 15% burred, feathered, or ragged edges . . . . .	X	
	Any untrimmed signatures . . . . .	X	
Level V	Greater than 25% burred, feathered, or ragged edges . . . . .	X	
	Any untrimmed signatures . . . . .	X	




### F-10. Warpage of Case-Bound Books (Cover and Text)

*Definition:* This is defined as a deviation of any page or cover from the horizontal plane formed by a copy when lying on a flat surface.

- Instruments:*
1. Visual Evaluation
  2. Ruler graduated in 1/64 and .020 in. (.1 mm).

*Procedure:* Place the copy on a flat surface. Measure the maximum deviation perpendicular to the flat surface.

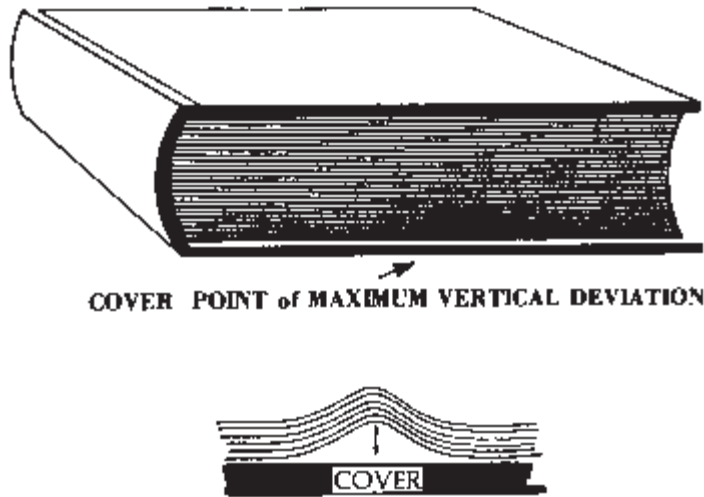

**Tolerance Table for Warpage of Case-Bound Books**

Product Quality Levels		<i>Classification of Defect</i>
		Major
Level I	Greater than .03 in. (.8 mm) .....	X
Level II	Greater than .03 in. (.8 mm) .....	X
Level III	Greater than .04 in. (1.0 mm) .....	X
Level IV	Greater than .10 in. (2.5 mm) .....	X
Level V	Greater than .12 in. (3.0 mm) .....	X

## F-11. Damaged Covers

*Definition:* Damaged covers consist of the following categories:

1. *Wrinkles*—Wrinkles are ridges, furrows, or creases formed on the smooth surface of the spine or cover. *Exception:* Wrinkles in the spine of perfect-bound books are classified under a separate tolerance table.
2. *Bubbles*—Bubbles are liftings of the paper or cloth covering on the surface of the cover or spine.
3. *Cuts*—Cuts are breaches in a cover which expose paper or cloth fibers.
4. *Scratches*—Scratches are blemishes which are visible under standard viewing conditions and which do not expose any paper or cloth fibers.

*Instruments:*

1. Visual Evaluation
2. Clear Plastic Grid consisting of 1/4 in. (6.35 mm) squares.

*Procedure:*

1. Measure damaged covers by placing the clear plastic grid over the entire surface of the book where the damage is located.
2. Count the squares which cover the damage.
3. Calculate the percentage of squares that cover the damage in relation to the number of squares in the entire area.
4. Classify the defect based on the edge of the copy that contains the maximum amount of damage.

**Tolerance Table for Damaged Covers\***

Product Quality Levels		Classification of Defect	
		Major	Critical
Level I	Any visible wrinkles, bubbles, or scratches . . . . .	X	
	Any cuts . . . . .		X
Level II	Any visible wrinkles, bubbles, or scratches . . . . .	X	
	Any cuts . . . . .		X
Level III	Greater than 10% wrinkles, bubbles, or scratches . . . . .	X	
	Any cuts . . . . .	X	
Level IV	Greater than 20% wrinkles, bubbles, or scratches . . . . .	X	
	Any cuts . . . . .	X	
Level V	Any cuts . . . . .	X	

\*Note: See following table regarding wrinkles in spine of perfect-bound books.

**Tolerance Table for Damaged Covers  
(Wrinkles on Spine of Perfect-Bound Books)**

Product Quality Levels		<i>Classification of Defect</i>
		Major
Level I	Any visible wrinkles (standard viewing conditions) .....	X
Level II	Greater than 10% .....	X
Level III	Greater than 20% .....	X
Level IV	Greater than 30% .....	X
Level V	Greater than 30% .....	X

---

**Tolerance Tables for Miscellaneous Finishing Attributes**


---

		<i>Classification of Defect</i>	
		Major	Critical
<b>F-12.</b>	<b>Missing Pages</b> . . . . . All Five PQLs . . . . .		X
<b>F-13.</b>	<b>Upside Down Cover</b> . . . . . All Five PQLs . . . . .		X
<b>F-14.</b>	<b>Upside Down Pages</b> . . . . . All Five PQLs . . . . .		X
<b>F-15.</b>	<b>Blank Pages—Other Than Specified</b> . . . . . All Five PQLs . . . . .		X
<b>F-16.</b>	<b>Wrong Pagination</b> . . . . . All Five PQLs . . . . .		X
<b>F-17.</b>	<b>Loss of Information</b> . . . . . All Five PQLs . . . . . Loss of information is defined as any omission of or damage to the printed image which impairs the transmission of the intended information.		X
<b>F-18.</b>	<b>A Serious Shift in Process Color Match</b> . . . . . Only PQL I . . . . . as defined in Printing Attribute P-10, Process Color Match.	X	

---

## A Guide for Equitable Reductions in the Contract Price

As a guide, reductions in the contract price will be based on the defects in the sample and will be calculated as follows:

- a. A discount for critical defects will be determined from the table in Appendix A.
- b. A discount for major defects will be determined from the table in Appendix B.
- c. The contract price will be reduced by the sum of the two discounts. However, the total reduction in the contract price will not exceed 25%. Appendices A & B list discounts as percentages of the contract price.

### Appendix A

#### Discount Table for Critical Defects

[In percent]

Number of critical defects	Number of Copies in Sample											
	2	3	5	8	13	20	32	50	80	125	200	315
1	5.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0
2	20.0	12.9	7.1	5.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0
3	25	25	21.9	13.2	7.5	5.0	5.0	5.0	5.0	5.0	5.0	5.0
4	25	25	25	23.0	13.6	8.3	5.0	5.0	5.0	5.0	5.0	5.0
5	25	25	25	25	20.2	12.6	7.4	5.0	5.0	5.0	5.0	5.0
6	25	25	25	25	25	17.2	10.2	6.0	5.0	5.0	5.0	5.0
7	25	25	25	25	25	22.0	13.2	8.0	5.0	5.0	5.0	5.0
8	25	25	25	25	25	25	16.3	9.9	5.7	5.0	5.0	5.0
9	25	25	25	25	25	25	19.5	12.0	7.0	5.0	5.0	5.0
10	25	25	25	25	25	25	22.8	14.1	8.3	5.0	5.0	5.0
11	25	25	25	25	25	25	25	16.2	9.6	5.6	5.0	5.0
12	25	25	25	25	25	25	25	18.4	10.9	6.5	5.0	5.0
13	25	25	25	25	25	25	25	20.5	12.3	7.4	5.0	5.0
14	25	25	25	25	25	25	25	22.8	13.7	8.2	5.0	5.0
15	25	25	25	25	25	25	25	25	15.1	9.1	5.2	5.0
16	25	25	25	25	25	25	25	25	16.5	10.0	5.7	5.0
17	25	25	25	25	25	25	25	25	17.9	11.0	6.3	5.0
18	25	25	25	25	25	25	25	25	19.3	11.9	6.9	5.0
19	25	25	25	25	25	25	25	25	20.8	12.8	7.5	5.0
20	25	25	25	25	25	25	25	25	22.2	13.7	8.0	5.0
21	25	25	25	25	25	25	25	25	23.7	14.7	8.6	5.0
22	25	25	25	25	25	25	25	25	25	15.6	9.2	5.3
23	25	25	25	25	25	25	25	25	25	16.5	9.8	5.7
24	25	25	25	25	25	25	25	25	25	17.5	10.4	6.1
25	25	25	25	25	25	25	25	25	25	18.4	11.0	6.5
26	25	25	25	25	25	25	25	25	25	19.4	11.6	6.8
27	25	25	25	25	25	25	25	25	25	20.4	12.2	7.2
28	25	25	25	25	25	25	25	25	25	21.3	12.8	7.6
29	25	25	25	25	25	25	25	25	25	22.3	13.4	8.0
30	25	25	25	25	25	25	25	25	25	23.2	14.0	8.4
31	25	25	25	25	25	25	25	25	25	24.2	14.6	8.7
32	25	25	25	25	25	25	25	25	25	25	15.2	9.1
33	25	25	25	25	25	25	25	25	25	25	15.8	9.5
34	25	25	25	25	25	25	25	25	25	25	16.4	9.9
35	25	25	25	25	25	25	25	25	25	25	17.0	10.3
36	25	25	25	25	25	25	25	25	25	25	17.0	10.7



## Appendix B

### Discount Table for Major Defects

[In percent]

Number of major defects	Number of Copies in Sample											
	2	3	5	8	13	20	32	50	80	125	200	315
1	5.0											
2	5.0	5.0	5.0	5.0								
3	9.8	5.9	5.0	5.0	5.0							
4	17.7	11.2	5.9	5.0	5.0	5.0						
5	25	16.9	9.4	5.2	5.0	5.0						
6	25	23.0	13.1	7.5	5.0	5.0	5.0					
7	25	25	16.9	9.9	5.4	5.0	5.0					
8	25	25	20.9	12.4	6.9	5.0	5.0	5.0				
9	25	25	25	14.9	8.5	5.0	5.0	5.0				
10	25	25	25	17.5	10.1	5.9	5.0	5.0				
11	25	25	25	20.2	11.7	7.0	5.0	5.0	5.0			
12	25	25	25	22.9	13.4	8.0	5.0	5.0	5.0			
13	25	25	25	25	15.0	9.1	5.0	5.0	5.0			
14	25	25	25	25	16.7	10.2	5.7	5.0	5.0			
15	25	25	25	25	18.5	11.4	6.4	5.0	5.0	5.0		
16	25	25	25	25	20.2	12.5	7.1	5.0	5.0	5.0		
17	25	25	25	25	21.9	13.6	7.8	5.0	5.0	5.0		
18	25	25	25	25	23.7	14.8	8.5	5.0	5.0	5.0		
19	25	25	25	25	25	15.9	9.3	5.3	5.0	5.0		
20	25	25	25	25	25	17.1	10.0	5.7	5.0	5.0		
21	25	25	25	25	25	18.2	10.7	6.2	5.0	5.0		
22	25	25	25	25	25	19.4	11.4	6.7	5.0	5.0	5.0	
23	25	25	25	25	25	20.6	12.2	7.1	5.0	5.0	5.0	
24	25	25	25	25	25	21.8	12.9	7.6	5.0	5.0	5.0	
25	25	25	25	25	25	23.0	13.7	8.1	5.0	5.0	5.0	
26	25	25	25	25	25	24.2	14.4	8.6	5.0	5.0	5.0	
27	25	25	25	25	25	25	15.2	9.0	5.0	5.0	5.0	
28	25	25	25	25	25	25	15.9	9.5	5.2	5.0	5.0	
29	25	25	25	25	25	25	16.7	10.0	5.6	5.0	5.0	
30	25	25	25	25	25	25	17.4	10.5	5.9	5.0	5.0	
31	25	25	25	25	25	25	18.2	11.0	6.2	5.0	5.0	5.0
32	25	25	25	25	25	25	18.9	11.5	6.5	5.0	5.0	5.0
33	25	25	25	25	25	25	19.7	11.9	6.8	5.0	5.0	5.0
34	25	25	25	25	25	25	20.5	12.4	7.1	5.0	5.0	5.0
35	25	25	25	25	25	25	21.2	12.9	7.4	5.0	5.0	5.0
36	25	25	25	25	25	25	22.0	13.4	7.7	5.0	5.0	5.0
37	25	25	25	25	25	25	22.8	13.9	8.0	5.0	5.0	5.0
38	25	25	25	25	25	25	23.6	14.4	8.3	5.0	5.0	5.0
39	25	25	25	25	25	25	24.3	14.9	8.6	5.0	5.0	5.0
40	25	25	25	25	25	25	25	15.4	8.9	5.0	5.0	5.0
41	25	25	25	25	25	25	25	15.9	9.2	5.2	5.0	5.0
42	25	25	25	25	25	25	25	16.4	9.5	5.4	5.0	5.0
43	25	25	25	25	25	25	25	16.9	9.9	5.6	5.0	5.0
44	25	25	25	25	25	25	25	17.4	10.2	5.8	5.0	5.0
45	25	25	25	25	25	25	25	17.9	10.5	6.0	5.0	5.0
46	25	25	25	25	25	25	25	18.4	10.8	6.2	5.0	5.0
47	25	25	25	25	25	25	25	18.9	11.1	6.4	5.0	5.0
48	25	25	25	25	25	25	25	19.4	11.4	6.6	5.0	5.0
49	25	25	25	25	25	25	25	19.8	11.7	6.8	5.0	5.0
50	25	25	25	25	25	25	25	20.3	12.0	7.0	5.0	5.0
51	25	25	25	25	25	25	25	20.8	12.3	7.2	5.0	5.0
52	25	25	25	25	25	25	25	21.3	12.6	7.4	5.0	5.0

## Discount Table for Major Defects—Continued

[In percent]

Number of major defects	Number of Copies in Sample											
	2	3	5	8	13	20	32	50	80	125	200	315
53	25	25	25	25	25	25	25	21.8	12.9	7.6	5.0	5.0
54	25	25	25	25	25	25	25	22.3	13.3	7.8	5.0	5.0
55	25	25	25	25	25	25	25	22.8	13.6	8.0	5.0	5.0
56	25	25	25	25	25	25	25	23.3	13.9	8.2	5.0	5.0
57	25	25	25	25	25	25	25	23.8	14.2	8.4	5.0	5.0
58	25	25	25	25	25	25	25	24.3	14.5	8.6	5.0	5.0
59	25	25	25	25	25	25	25	24.9	14.8	8.8	5.0	5.0
60	25	25	25	25	25	25	25	25	15.2	9.0	5.0	5.0
61	25	25	25	25	25	25	25	25	15.5	9.2	5.1	5.0
62	25	25	25	25	25	25	25	25	15.8	9.4	5.2	5.0
63	25	25	25	25	25	25	25	25	16.1	9.6	5.3	5.0
64	25	25	25	25	25	25	25	25	16.4	9.9	5.5	5.0
65	25	25	25	25	25	25	25	25	16.8	10.1	5.6	5.0
66	25	25	25	25	25	25	25	25	17.1	10.3	5.7	5.0
67	25	25	25	25	25	25	25	25	17.4	10.5	5.8	5.0
68	25	25	25	25	25	25	25	25	17.7	10.7	6.0	5.0
69	25	25	25	25	25	25	25	25	18.0	10.9	6.1	5.0
70	25	25	25	25	25	25	25	25	18.4	11.1	6.2	5.0
71	25	25	25	25	25	25	25	25	18.7	11.3	6.4	5.0
72	25	25	25	25	25	25	25	25	19.0	11.5	6.5	5.0
73	25	25	25	25	25	25	25	25	19.3	11.7	6.6	5.0
74	25	25	25	25	25	25	25	25	19.7	11.9	6.7	5.0
75	25	25	25	25	25	25	25	25	20.0	12.1	6.9	5.0
76	25	25	25	25	25	25	25	25	20.3	12.3	7.0	5.0
77	25	25	25	25	25	25	25	25	20.6	12.5	7.1	5.0
78	25	25	25	25	25	25	25	25	20.9	12.7	7.3	5.0
79	25	25	25	25	25	25	25	25	21.3	12.9	7.4	5.0
80	25	25	25	25	25	25	25	25	21.6	13.2	7.5	5.0
81	25	25	25	25	25	25	25	25	21.9	13.4	7.7	5.0
82	25	25	25	25	25	25	25	25	22.2	13.6	7.8	5.0
83	25	25	25	25	25	25	25	25	22.6	13.8	7.9	5.0
84	25	25	25	25	25	25	25	25	22.9	14.0	8.0	5.0
85	25	25	25	25	25	25	25	25	23.2	14.2	8.2	5.0
86	25	25	25	25	25	25	25	25	23.5	14.4	8.3	5.0
87	25	25	25	25	25	25	25	25	23.9	14.6	8.4	5.0
88	25	25	25	25	25	25	25	25	24.2	14.8	8.6	5.0
89	25	25	25	25	25	25	25	25	24.5	15.0	8.7	5.0
90	25	25	25	25	25	25	25	25	24.8	15.2	8.8	5.0
91	25	25	25	25	25	25	25	25	25	15.4	9.0	5.0
92	25	25	25	25	25	25	25	25	25	15.7	9.1	5.1
93	25	25	25	25	25	25	25	25	25	15.9	9.2	5.2
94	25	25	25	25	25	25	25	25	25	16.1	9.3	5.3
95	25	25	25	25	25	25	25	25	25	16.3	9.5	5.3
96	25	25	25	25	25	25	25	25	25	16.5	9.6	5.4
97	25	25	25	25	25	25	25	25	25	16.7	9.7	5.5
98	25	25	25	25	25	25	25	25	25	16.9	9.9	5.6
99	25	25	25	25	25	25	25	25	25	17.1	10.0	5.7
100	25	25	25	25	25	25	25	25	25	17.3	10.1	5.8
101	25	25	25	25	25	25	25	25	25	17.5	10.3	5.8
102	25	25	25	25	25	25	25	25	25	17.7	10.4	5.9
103	25	25	25	25	25	25	25	25	25	18.0	10.5	6.0
104	25	25	25	25	25	25	25	25	25	18.2	10.7	6.1
105	25	25	25	25	25	25	25	25	25	18.4	10.8	6.2
106	25	25	25	25	25	25	25	25	25	18.6	10.9	6.3
107	25	25	25	25	25	25	25	25	25	18.8	11.1	6.3











Adhesive		improper packing . . . . .(CT3j) . . . . .7
excessive . . . . .(F-7) . . . . .37		mislabeled . . . . .(CT4a) . . . . .8
not durable . . . . .(F-5) . . . . .34		not packed solidly . . . . .(CT3j) . . . . .7
(F-6) . . . . .36		not taped securely . . . . .(CT3j) . . . . .7
Backstrip		wrong size . . . . .(CT3j) . . . . .7
missing copy . . . . .(F-17) . . . . .44		wrong weight . . . . .(CT3j) . . . . .7
Banding		Case Bound Books
broken . . . . .(CT3f) . . . . .7		cover creases . . . . .(F-11) . . . . .42
not done . . . . .(CT3f) . . . . .7		cover damage . . . . .(F-11) . . . . .42
too narrow . . . . .(CT3f) . . . . .7		cover furrows . . . . .(F-11) . . . . .42
wrong quantity . . . . .NPS		cover ridges . . . . .(F-11) . . . . .42
Bar Coding		cover warped . . . . .(F-10) . . . . .41
missing . . . . .(F-17) . . . . .44		cover wrinkles . . . . .(F-11) . . . . .42
not readable . . . . .(F-17) . . . . .44		durability . . . . .(F-6) . . . . .36
numbering—		extra blank pages . . . . .(F-15) . . . . .44
not consecutive . . . . .NPS		loose end sheets . . . . .(F-6) . . . . .36
wrong system . . . . .NPS		loose pages . . . . .(F-6) . . . . .36
Binding		missing pages . . . . .(F-12) . . . . .44
loose pages . . . . .(F-5) . . . . .34		sewing missing . . . . .NPS
(F-6) . . . . .36		spine creases . . . . .(F-11) . . . . .42
wrong kind . . . . .NPS		spine furrows . . . . .(F-11) . . . . .42
wrong position . . . . .NPS		spine ridges . . . . .(F-11) . . . . .42
Blank Pages		spine wrinkles . . . . .(F-11) . . . . .42
additional . . . . .(F-15) . . . . .44		sewing broken . . . . .(F-6) . . . . .36
missing copy . . . . .(F-17) . . . . .44		torn end sheets . . . . .(F-6) . . . . .36
Bleed		torn pages . . . . .(F-8) . . . . .38
not occurring . . . . .(P-5) . . . . .11		upside down cover . . . . .(F-13) . . . . .44
unintentional . . . . .(P-5) . . . . .11		upside down pages . . . . .(F-14) . . . . .44
Bleed through . . . . .(P-2) . . . . .6		warpage . . . . .(F-10) . . . . .41
Blue Box Sample		wrong pagination . . . . .(F-16) . . . . .44
missing certificate . . . . .NPS		Collation
missing specifications . . . . .NPS		wrong . . . . .(F-16) . . . . .44
not supplied . . . . .NPS		Contractor Advertising
shortage . . . . .NPS		on carton . . . . .(CT4) . . . . .8
Broken Type . . . . .(P-7) . . . . .15		on label . . . . .(CT4) . . . . .8
Bundles		Contractor ID
breaking open . . . . .(CT3h) . . . . .7		on product . . . . .(CT9) . . . . .9
not tied . . . . .(CT3h) . . . . .7		Copy
not wrapped . . . . .(CT3h) . . . . .7		missing because of—
unlabeled . . . . .(CT4a) . . . . .8		finishing . . . . .(F-17) . . . . .44
Cartons		ink loss . . . . .(F-17) . . . . .44
broken . . . . .(CT3j) . . . . .7		stripping . . . . .(F-17) . . . . .44
contractor advertising . . . . .(CT4) . . . . .8		too dark . . . . .(P-7) . . . . .15
		too light . . . . .(P-7) . . . . .15
		unreadable . . . . .(F-17) . . . . .44
		wrong pagination . . . . .(F-16) . . . . .38
		Cover(s)
		cut . . . . .(F-11) . . . . .42

damaged . . . . .(F-11) . . .42	wrong quantity shipped . . . . .NPS
loose . . . . .(F-6) . . .36	
missing . . . . .(F-12) . . .44	Dog Eared
missing copy . . . . .(F-17) . . .44	cover . . . . .(F-11) . . .42
not square . . . . .(F-1) . . .27	pages . . . . .(F-8) . . .38
not flush . . . . .(F-3) . . .31	
scratched . . . . .(F-11) . . .42	Doubling . . . . .(P-7) . . .15
scuffed . . . . .(P-11) . . .25	
	(F-11) . . .42
stiches loose . . . . .(F-6) . . .36	Drilling
upside down . . . . .(F-13) . . .44	missing . . . . .NPS
wrinkled . . . . .(F-11) . . .42	wrong place . . . . .NPS
wrong binding . . . . .NPS	wrong size . . . . .NPS
wrong ink color . . . . .NPS	
wrong paper . . . . .NPS	Duotone
wrong position . . . . .NPS	missing color . . . . .NPS
	moire . . . . .(P-3) . . .8
Cover Image	out of register . . . . .(P-4) . . .9
misaligned . . . . .(F-2) . . .29	
misplaced . . . . .(F-2) . . .29	Edges
skewed . . . . .(F-2) . . .29	damaged—
wrong position . . . . .(F-2) . . .29	text . . . . .(F-9) . . .40
	cover . . . . .(F-11) . . .42
Crossover	
colored mismatched . . . . .(P-9) . . .22	Embossing
	missing . . . . .NPS
	out of register . . . . .(CT2) . . .7
	skewed . . . . .(P-5) . . .11
	(F-2) . . .29
	(CT2) . . .7
	wrong position . . . . .(P-5) . . .11
	(F-2) . . .29
	(CT2) . . .7
Damaged	
cover . . . . .(F-11) . . .42	End Sheets
cover (warped) . . . . .(F-10) . . .41	loose . . . . .(F-6) . . .36
pages . . . . .(F-8) . . .38	missing . . . . .NPS
text edges . . . . .(F-9) . . .40	torn . . . . .(F-6) . . .36
text pages . . . . .(F-8) . . .38	
	Envelopes
Delivery	glue—
late . . . . .NPS	not holding . . . . .(CT2) . . .7
mislabeled . . . . .(CT4b) . . .8	prestuck . . . . .(CT2) . . .7
pallets—	wrong place . . . . .NPS
not used . . . . .(CT8) . . .8	stuck together . . . . .(CT2) . . .7
wrong packing . . . . .(CT8) . . .8	warped . . . . .(CT2) . . .7
short . . . . .(CT11) . . .15	
wrong place . . . . .(CT5) . . .8	Excess Glue . . . . .(F-7) . . .37
Die Cutting	Extraneous Marks
missing . . . . .NPS	bleed through . . . . .(P-2) . . .6
out of register . . . . .NPS	gear marks . . . . .(P-2) . . .6
skewed . . . . .NPS	hickies . . . . .(P-1) . . .5
wrong die . . . . .NPS	ink bleed through . . . . .(P-2) . . .6
	negative marks . . . . .(P-2) . . .6
Distribution	
shipment not made . . . . .(CT5) . . .8	
wrong labeling . . . . .(CT4) . . .8	
wrong product shipped . . . . .NPS	

oil marks . . . . .(P-2) . . . . .6	wrong numbering . . . . .NPS
plate scratches . . . . .(P-2) . . . . .6	wrong packing . . . . .NPS
scratches . . . . .(P-2) . . . . .6	wrong stub . . . . .NPS
scumming . . . . .(P-2) . . . . .6	
set off . . . . .(P-2) . . . . .6	Furnished Material
show through . . . . .(CT2) . . . . .7	excess—
smearing . . . . .(P-2) . . . . .6	not returned . . . . .(CT10c) . .15
spots . . . . .(P-1) . . . . .5	not returned . . . . .(CT10a) . .15
strike through . . . . .(CT2) . . . . .7	not used . . . . .NPS
Facing Pages	Gas Ghosting . . . . .(P-9) . . . . .22
color mismatched . . . . .(P-8) . . . . .19	
. . . . .(P-9) . . . . .22	Gear—
. . . . .(P-10) . . . . .23	marks . . . . .(P-2) . . . . .6
misaligned . . . . .(P-5) . . . . .11	streaks . . . . .(P-2) . . . . .6
. . . . .(F-4) . . . . .32	
Foil Stamping	Ghosting . . . . .(P-2) . . . . .6
missing . . . . .NPS	. . . . .(P-9) . . . . .22
not adhering . . . . .(CT2) . . . . .7	
. . . . .(F-17) . . . . .44	GPO Imprint
out of register . . . . .(CT2) . . . . .7	missing . . . . .(CT9) . . . . .9
skewed . . . . .(P-5) . . . . .11	wrong copy . . . . .(CT9) . . . . .9
. . . . .(F-2) . . . . .29	
wrong color . . . . .NPS	Glue
wrong die . . . . .NPS	excess . . . . .(F-7) . . . . .37
wrong position . . . . .NPS	missing . . . . .(F-5) . . . . .34
	. . . . .(F-6) . . . . .36
Folding	not durable . . . . .(F-5) . . . . .34
not square . . . . .(F-4) . . . . .32	not holding . . . . .(F-5) . . . . .34
skewed . . . . .(F-4) . . . . .32	. . . . .(F-6) . . . . .36
undesired . . . . .NPS	
wrinkles . . . . .(F-8) . . . . .38	Halftones
. . . . .(F-11) . . . . .42	bleed—
wrong kind . . . . .NPS	not occurring . . . . .(P-5) . . . . .11
wrong position . . . . .(F-4) . . . . .32	unintentional . . . . .(P-5) . . . . .11
	blurred . . . . .(P-8) . . . . .19
Folio numbers	contrast—
missing . . . . .(F-17) . . . . .44	too contrasty . . . . .(P-8) . . . . .19
skewed . . . . .(P-5) . . . . .11	too flat . . . . .(P-8) . . . . .19
wrong number . . . . .(F-17) . . . . .44	density—
wrong position . . . . .(P-5) . . . . .11	not matched . . . . .(P-8) . . . . .19
. . . . .(F-4) . . . . .32	too dark . . . . .(P-8) . . . . .19
	too light . . . . .(P-8) . . . . .19
Forms	detail lost . . . . .(P-8) . . . . .19
packing—	. . . . .(F-17) . . . . .44
wrong number order . . . . .(CT3a) . . . . .7	flopped . . . . .NPS
parts misaligned . . . . .(CT12f) . . . . .9	misaligned . . . . .(P-5) . . . . .11
perforation—	misplaced . . . . .(P-5) . . . . .11
missing . . . . .NPS	missing . . . . .(F-17) . . . . .44
skewed . . . . .(CT2) . . . . .7	missing captions . . . . .(F-17) . . . . .44
stub perforation—	mottled . . . . .(P-8) . . . . .19
missing . . . . .(CT12g) . . . . .9	multicolor—
tenting . . . . .(CT2) . . . . .7	register . . . . .(P-4) . . . . .9
wrinkled . . . . .(CT2) . . . . .7	not matched . . . . .(P-8) . . . . .19

- plugged .....(P-8) .....19  
 skewed .....(P-5) .....11  
 upside down .....NPS  
 wrong caption .....(F-14) .....44  
 wrong cropping .....NPS  
 wrong image .....(F-17) .....44  
 wrong position .....(P-5) .....11  
 wrong size .....NPS
- Hickies .....(P-1) .....5
- Hole drilling
- missing .....NPS
  - wrong number .....NPS
  - wrong position .....NPS
  - wrong size .....NPS
- Illustrations (line)  
(See also halftones)
- bleed—
- not occurring .....(P-5) .....11
  - unintentional .....(P-5) .....11
- flopped .....NPS
- misaligned .....(P-5) .....11
- misplaced .....(P-5) .....11  
 (F-2) .....29
- missing .....(F-17) .....44
- missing caption .....(F-17) .....44
- multicolor—
- register .....(P-4) .....9
- skewed .....(P-5) .....11
- upside down .....NPS
- wrong caption .....(F-17) .....44
- wrong cropping .....NPS
- wrong image .....(F-2) .....29  
 (F-17) .....44
- wrong position .....(P-5) .....11
- wrong size .....NPS
- Image Position
- bleeds—
- not occurring .....(P-5) .....11
  - unintentional .....(P-5) .....11
- misaligned .....(P-5) .....11  
 (F-2) .....29
- misplaced .....(P-5) .....11  
 (F-2) .....29
- skewed .....(P-5) .....11  
 (F-2) .....29
- Image Ruboff .....(P-11) .....25
- Image Transfer (Forms)
- desired—
- not occurring properly
- (NCR) .....(CT2) .....7  
 (OPAS) .....(CT2) .....7  
 undesired .....(CT2) .....7  
 wrong position .....NPS
- Imposition
- wrong .....(F-16) .....44
- Imprint (GPO)
- missing .....(CT9) .....9
  - wrong .....(F-17) .....44
- Incorrect—
- information printed .....(F-17) .....44
- Information Loss
- due to finishing .....(F-17) .....44
  - due to ink loss .....(F-17) .....44
- Ink
- bleed through .....(P-2) .....6
- chalking .....(P-9) .....22
- color not matched .....(P-9) .....22  
 (P-10) .....23
- cracking .....(F-11) .....42  
 (CT2) .....7
- density—
- not matched .....(P-9) .....22
- doubling .....(P-7) .....15  
 (P-8) .....19  
 (P-10) .....23
- extraneous marks .....(P-2) .....6
- fading .....(CT2) .....7
- ghosting .....(P-9) .....22
- missing .....(P-9) .....22  
 (F-17) .....44
- mottled .....(P-9) .....22
- not matching .....(P-9) .....22
- offcolor spots .....(P-1) .....5
- offset .....(P-2) .....6
- register .....(P-4) .....9
- rub resistance .....(P-11) .....25
- scuffing .....(P-11) .....25
- scumming .....(P-2) .....6  
 (P-9) .....22
- setoff .....(P-2) .....6
- showthrough .....(CT2) .....7
- smearing .....(P-2) .....6  
 (P-10) .....23
- splatter .....(P-1) .....5
- spots .....(P-1) .....5
- streaking .....(P-2) .....6  
 (P-10) .....23  
 (P-9) .....22



strikerthrough . . . . .	(P-2) . . . . .6	Mailing Container	
tinting . . . . .	(P-2) . . . . .6	not supplied . . . . .	NPS
	(P-9) . . . . .22	number taped over . . . . .	(CT3i) . . . . .7
too dark . . . . .	(P-7) . . . . .15	not snug . . . . .	(CT3i) . . . . .7
	(P-9) . . . . .22	wrong flute . . . . .	(CT3i) . . . . .7
too light . . . . .	(P-7) . . . . .15		
	(P-9) . . . . .22	Marginally Punched Forms	
trapping . . . . .	(P-4) . . . . .9	copy misaligned . . . . .	(CT12f) . . . . .9
	(P-9) . . . . .22	missing copy . . . . .	NPS
wheel marks . . . . .	(P-2) . . . . .6	parts misaligned . . . . .	(CT12f) . . . . .9
wrong color . . . . .	(P-9) . . . . .22	tenting . . . . .	(CT2) . . . . .7
	(P-10) . . . . .23	wrong copy . . . . .	NPS
wrong position . . . . .	(P-5) . . . . .11	wrong packing . . . . .	(CT3) . . . . .7
Inserting		Marking . . . . .	(P-2) . . . . .6
backwards . . . . .	NPS	Misaligned Image . . . . .	(P-5) . . . . .11
upside down . . . . .	NPS		(F-2) . . . . .29
wrong item . . . . .	NPS	Misplaced Image . . . . .	(P-5) . . . . .11
wrong order . . . . .	NPS		(F-2) . . . . .29
wrong position . . . . .	NPS		
		Misregister	
Line Work		duotones . . . . .	(P-4) . . . . .9
misregister . . . . .	(P-4) . . . . .9	halftones . . . . .	(P-4) . . . . .9
		linework & solids . . . . .	(P-4) . . . . .9
Labeling		process color . . . . .	(P-4) . . . . .9
contractor ad . . . . .	(CT4) . . . . .8	Multipart Forms	
missing . . . . .	(CT4) . . . . .8	parts not matching . . . . .	(CT2) . . . . .7
	(CT) . . . . .11	Moire . . . . .	(P-3) . . . . .8
wrong information . . . . .	(CT4) . . . . .8	Negatives	
	(CT) . . . . .11	not returned . . . . .	(CT10a) . . . . .15
wrong place . . . . .	(CT4) . . . . .8	returned—	
	(CT) . . . . .11	not off flats . . . . .	(CT10b) . . . . .9
wrong type of label . . . . .	(CT4) . . . . .8	not one piece . . . . .	(CT10b) . . . . .9
	(CT) . . . . .11	not supplied . . . . .	NPS
Laminating		wrong negs used . . . . .	(F-17) . . . . .44
separating . . . . .	(CT2) . . . . .7		
wrinkled . . . . .	(CT2) . . . . .7	Newton's Rings . . . . .	(P-6) . . . . .14
		One Piece Film	
Loose		not composited . . . . .	(CT10b) . . . . .9
binding . . . . .	(F-6) . . . . .36	not supplied . . . . .	NPS
cover . . . . .	(F-6) . . . . .36	still on flats . . . . .	(CT10b) . . . . .9
text pages . . . . .	(F-6) . . . . .36		
Mailing		Opaquing	
wrong class . . . . .	NPS	not done . . . . .	(P-1) . . . . .5
wrong labels . . . . .	NPS		(P-2) . . . . .6
wrong name match . . . . .	NPS		(CT10b) . . . . .9
wrong order in carrier . . . . .	NPS	Packing	
wrong postage . . . . .	NPS	incorrect . . . . .	(CT3) . . . . .7
wrong sorting . . . . .	NPS		

## Padding

excess glue	CT2
loose sheets	CT2
missing backing	NPS
wrong backing	NPS
wrong number/pad	NPS

## Pages

blank	(F-15) . . . 44
	(F-17) . . . 44
connected	(F-8) . . . 38
	(F-9) . . . 40
cut	(F-8) . . . 38
damaged	(F-8) . . . 38
damaged edges	(F-9) . . . 40
loose	(F-5) . . . 34
	(F-6) . . . 36
misnumbered	(F-17) . . . 44
missing	(F-12) . . . 44
not trimmed	(F-8) . . . 38
	(F-9) . . . 40
torn	(F-8) . . . 38
untrimmed	(F-8) . . . 38
	(F-9) . . . 40
upside down	(F-14) . . . 44
	(F-14) . . . 44
wrinkled	(F-8) . . . 38
wrong imposition	(F-16) . . . 44

## Pagination

excess blanks	(F-15) . . . 44
missing blanks	(F-12) . . . 44
missing pages	(F-12) . . . 44
wrong imposition	(F-16) . . . 44
wrong pagination	(F-16) . . . 44

## Paper

sample—	
not matched	NPS
scratches—	
in coating	3
spots due to—	
picking	3
	(P-1) . . . 5
uneven thickness	3
unsquare trim	3
wrong brightness	3
wrong color	3
wrong kind	3
wrong opacity	3
wrong thickness	3
wrong weight	3

## Perfect Bound Books

cover creases	(F-11) . . . 42
cover furrows	(F-11) . . . 42
cover wrinkles	(F-11) . . . 42
damaged cover(s)	(F-11) . . . 42
damaged edges	(F-9) . . . 40
damaged pages	(F-8) . . . 38
durability	(F-5) . . . 34
excess glue	(F-7) . . . 37
extra blank pages	(F-15) . . . 44
loose binding	(F-6) . . . 36
loose cover(s)	(F-6) . . . 36
loose page(s)	(F-5) . . . 34
	(F-6) . . . 36
missing pages	(F-12) . . . 44
spine wrinkles	(F-11) . . . 42
torn pages	(F-8) . . . 38
upside down cover	(F-13) . . . 44
upside down pages	(F-14) . . . 44
wrong pagination	(F-16) . . . 44

## Perforation

missing	NPS
wrong place	NPS
wrong size	NPS

Photographs . . . . . see Halftones

## Press Sheet

color—	
not matched	(P-9) . . . 22
	(P-10) . . . 23
corrections—	
not made	NPS
halftones—	
not matched	(P-8) . . . 19
process color—	
not matched	(P-10) . . . 23

## Process Color

match	(P-10) . . . 23
register	(P-4) . . . 9
shift	(F-18) . . . 44

## Proof

correction—	
not made	(F-17) . . . 44
missing proofs	(CT15) . . . 10
not proofread	(CT15) . . . 10
poor repros	(CT18d) . . . 10

Quality Assurance Copies	
missing certificate . . . . .	NPS
missing P.O. . . . .	NPS
not sent . . . . .	NPS
Readacross	
1 color—	
image not matched . . . . .	(P-5) . . . . 11
color not matched . . . . .	(P-8) . . . . 19
	(P-9) . . . . 22
4 color—	
image not matched . . . . .	(P-5) . . . . 11
color not matched . . . . .	(P-8) . . . . 19
halftone—	
image not matched . . . . .	(P-5) . . . . 11
ink not matched . . . . .	(P-8) . . . . 19
Register	
halftone . . . . .	(P-4) . . . . 9
line work . . . . .	(P-4) . . . . 9
process color . . . . .	(P-4) . . . . 9
Reverses	
filled in . . . . .	(P-7) . . . . 15
not occurring . . . . .	NPS
Roller marks . . . . .	(P-2) . . . . 6
Roundcornering	
missing . . . . .	NPS
wrong place . . . . .	NPS
wrong size . . . . .	NPS
Rub Resistance	
printed image . . . . .	(P-11) . . . . 25
varnish . . . . .	(P-11) . . . . 25
Saddlestitched Books	
cover damage . . . . .	(F-11) . . . . 42
cover missing . . . . .	(F-12) . . . . 44
cracked spine ink . . . . .	(CT2) . . . . 7
dog-eared cover . . . . .	(F-11) . . . . 42
dog-eared pages . . . . .	(F-8) . . . . 38
extra blank pages . . . . .	(F-15) . . . . 44
loose pages . . . . .	(F-6) . . . . 34
missing pages . . . . .	(F-12) . . . . 44
stitching—	
missing . . . . .	NPS
not done . . . . .	NPS
wrong position . . . . .	NPS
torn pages . . . . .	(F-8) . . . . 38
upside down cover . . . . .	(F-13) . . . . 44
wrong pagination . . . . .	(F-16) . . . . 44
Samples	
missing blue label . . . . .	NPS
missing QAC's . . . . .	NPS
Screens	
holes . . . . .	(P-9) . . . . 22
moire . . . . .	(P-3) . . . . 8
mottled . . . . .	(P-9) . . . . 22
Newton's rings . . . . .	(P-6) . . . . 14
not matched . . . . .	(P-9) . . . . 22
register . . . . .	(P-4) . . . . 9
wrong density . . . . .	(P-9) . . . . 2
Scoring	
missing . . . . .	NPS
not deep enough . . . . .	(CT2) . . . . 7
too deep (cutting) . . . . .	(F-8) . . . . 38
	(F-11) . . . . 42
skewed . . . . .	(F-4) . . . . 32
wrong position . . . . .	(F-4) . . . . 32
Shipping	
damage . . . . .	(CT2) . . . . 7
late delivery . . . . .	NPS
pallet(s)—	
missing . . . . .	(CT8) . . . . 8
wrong packing . . . . .	(CT8) . . . . 8
	(CT) . . . . 12
wrong pallet . . . . .	(CT8) . . . . 8
wrong container . . . . .	(CT3) . . . . 7
Shrink Wrapping	
broken open . . . . .	(CT3c) . . . . 7
burned . . . . .	(CT3c) . . . . 7
missing backing . . . . .	(CT3c) . . . . 7
missing component . . . . .	(CT3c) . . . . 7
oversize . . . . .	(CT3c) . . . . 7
torn . . . . .	(CT3c) . . . . 7
wrong quantity . . . . .	(CT3c) . . . . 7
wrong thickness . . . . .	(CT3c) . . . . 7
Shortage	
blue box (randoms) . . . . .	NPS
QAC samples . . . . .	NPS
total . . . . .	(CT11a) . . . . 15
Solid color	
match . . . . .	(P-9) . . . . 22
register . . . . .	(P-4) . . . . 9
Spine	
cracked ink . . . . .	(CT2) . . . . 7
missing copy . . . . .	(F-17) . . . . 44

- Spots .....(P-1) .....5
- Stitching (sewn)—  
 broken .....(F-6) .....34  
 missing .....NPS
- Stitching (wire)—  
 missing .....NPS  
 wrong place .....NPS
- Stock .....See Paper
- Strike Through .....(P-2) .....6
- Tabs  
 missing copy .....(F-17) .....44  
 wrong copy .....(F-17) .....44  
 wrong shape .....NPS  
 (CT2) .....7  
 wrong size .....NPS
- Text  
 misaligned .....(P-5) .....11  
 missing .....(F-17) .....44  
 misplaced .....(P-5) .....11  
 skewed .....(P-5) .....11  
 upside down page .....(F-14) .....44  
 wrong pagination .....(F-16) .....44  
 wrong position .....(P-5) .....11  
 wrong trim size .....(F-1) .....27
- Tints  
 missing .....(P-9) .....22  
 mottled .....(P-9) .....22  
 not matched .....(P-9) .....22  
 wrong color .....(F-18) .....44  
 wrong density .....(P-9) .....22
- Trim  
 nonflush trim .....(F-1) .....27  
 unsquare .....(F-1) .....27
- untrimmed .....(F-8) .....38  
 .....(F-9) .....40  
 wrong size .....(F-1) .....27
- Type  
 broken .....(P-7) .....15  
 corrections—  
 not made .....NPS  
 missing .....(F-17) .....44  
 not uniform color .....(P-7) .....15  
 not uniform size .....(P-7) .....15  
 too light .....(P-7) .....15  
 uneven density .....(P-7) .....15  
 wrong color .....(P-7) .....15  
 wrong copy .....(F-17) .....44  
 wrong size .....(P-7) .....15
- Untrimmed Pages .....(F-8) .....38  
 .....(F-9) .....40
- Upside Down  
 cover .....(F-13) .....44  
 illustration .....NPS  
 text pages .....(F-14) .....44
- Varnish  
 missing .....NPS  
 wrong color .....NPS  
 wrong type .....NPS  
 wrong place .....NPS
- Warped cover—  
 case bound .....(F-10) .....41
- Wrinkled  
 backstrip .....(F-11) .....42  
 covers .....(F-11) .....42  
 endleaves .....(F-6) .....34  
 pages .....(F-8) .....38  
 spine .....(F-11) .....42